

General Information

Date & Time: 23, Feb, 2026 13:53

Make	Toyota	Model	Innova
YOM	2005	Odo Meter Reading	151,269
Registration No.	ZBF832 - NON-MOVING	Chassis No.	KUN405005196
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



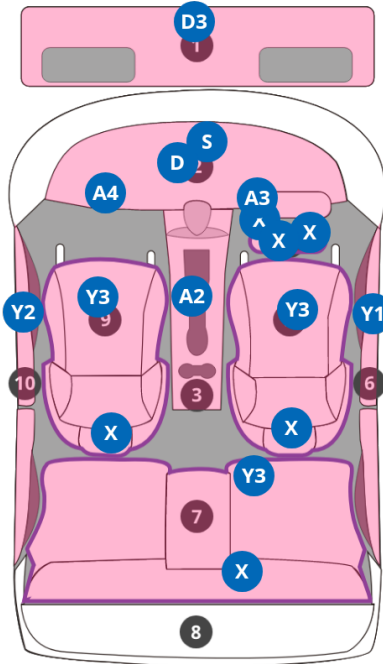
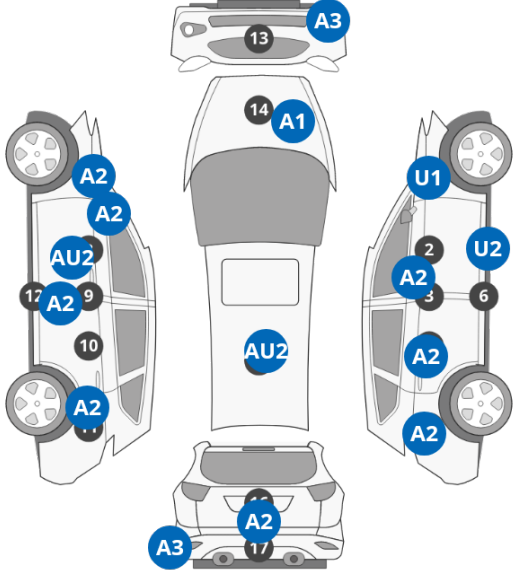
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	226.3	229	253	197
2	Boot Lid	229.6	222	206	261
3	Roof	139.5	122	146	156/134
4	Left Front Fender	207.6	199	217	207
5	Left Front Door	176.3	153	171	205
6	Center Panel Left				
7	Left Rear Door	193.6	202	192	187
8	Left Back Panel	183.3	224	177	149
9	Right Front Fender	301.3	250	273	381
10	Right Front Door	331.3	339	326	329
11	Center Panel Right				
12	Right Rear Door	311.0	298	313	322
13	Right Back Panel	282.6	287	248	313

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Crinkle - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Rear Seat Head Rest - Missing - Yes / (R) Front Seat Head Rest - Missing - Yes / (L) Front Seat Head Rest - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Glove Box - Worn, Scratch, Cut, Crack - Medium / Knobs - Worn, Peel, Crack - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Front Fender, Molding - Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack headlights and tail light, non moving unit, functional can't be verified due to non moving vehicle, rear door issue, all headrest missing,