

General Information

Date & Time: 03, Feb, 2026 12:39

Make	Toyota	Model	Rush
YOM	2021	Odo Meter Reading	53,692
Registration No.	EAF7160	Chassis No.	MHKE8FF3PLK025636
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Brown		

Body / Panel Condition



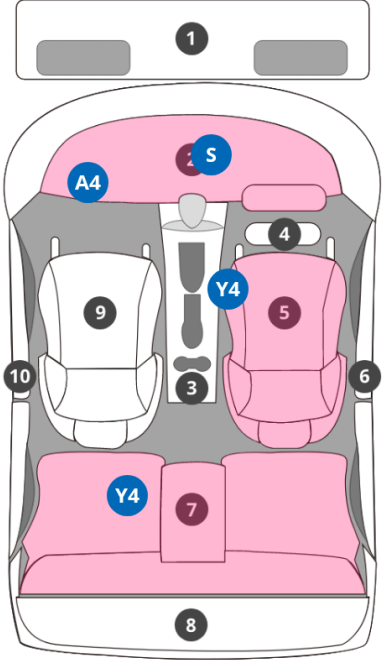
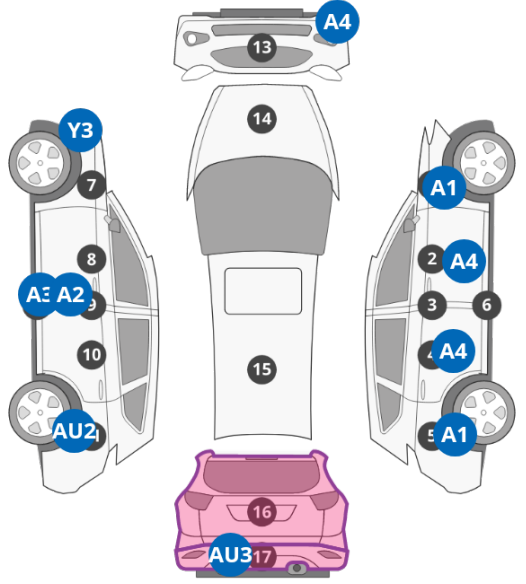
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	110	112	104
2	Boot Lid	159.3	150	164	164
3	Roof	89.6	77	79	99/104
4	Left Front Fender	106.6	110	113	97
5	Left Front Door	102.0	94	106	106
6	Center Panel Left				
7	Left Rear Door	108.3	114	107	104
8	Left Back Panel	100.3	100	93	108
9	Right Front Fender	94.1	93	96	93
10	Right Front Door	100.9	99	102	102
11	Center Panel Right				
12	Right Rear Door	98.6	95	99	102
13	Right Back Panel	102.4	109	96	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Steering Wheel - Worn, Peel, Crack - Large / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Overall Interior - Smell - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>transmission issue/ abnormal jerking while reversing /no warranty booklet/ no tools/ no jack/ with spare tire and LTO plate</p>