

General Information

Date & Time: 02, Feb, 2026 16:02

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	49,059
Registration No.	DAQ1953	Chassis No.	PA1B18F30N4173348
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



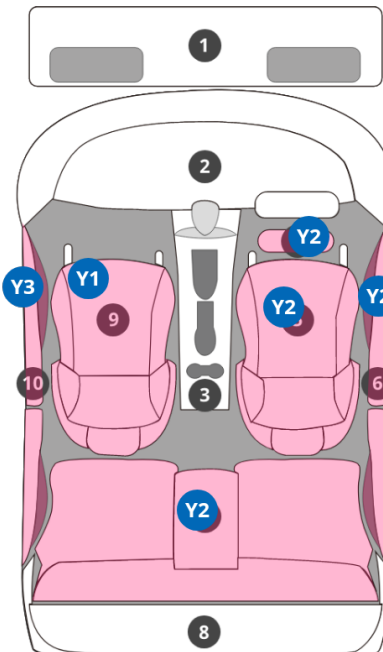
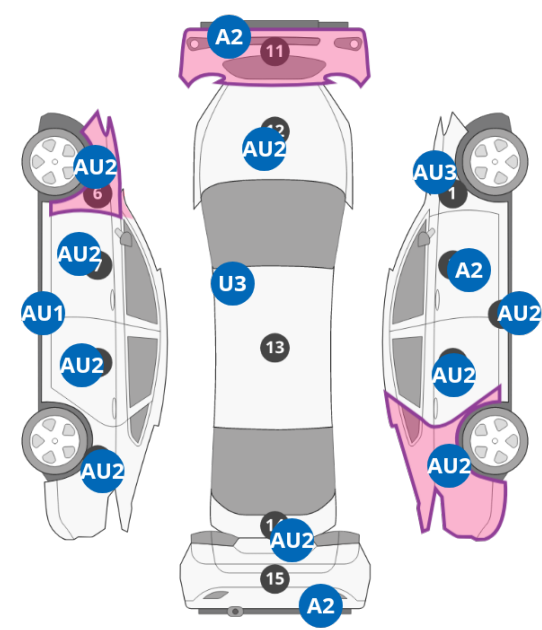
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	130	106	107
2	Boot Lid	123.6	108	162	101
3	Roof	104.3	105	108	96/109
4	Left Front Fender	105.7	96	96	125
5	Left Front Door	101.9	101	100	105
6	Center Panel Left				
7	Left Rear Door	102.8	106	103	100
8	Left Back Panel	112.3	114	122	101
9	Right Front Fender	109.3	117	105	106
10	Right Front Door	120.0	117	137	106
11	Center Panel Right				
12	Right Rear Door	111.3	113	106	115
13	Right Back Panel	108.8	125	96	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small	Remarks Roof - Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes	
with LTO plate, with spare tire, with incomplete tools and jack, with warranty booklet, no reverse camera, scratches on taillight and headlight, no spare key.	