

General Information

Date & Time: 20, Feb, 2026 15:54

Make	Suzuki	Model	Ertiga
YOM	2025	Odo Meter Reading	5,484
Registration No.	KNV1827	Chassis No.	MHYNC32S4SJ101371
CC	1.5	Transmission	A/T
Fuel Type	Hybrid	Type of Body	Wagon
Colour	White		

Body / Panel Condition



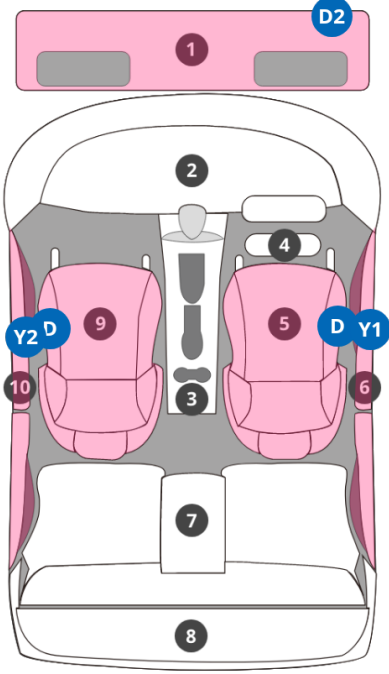
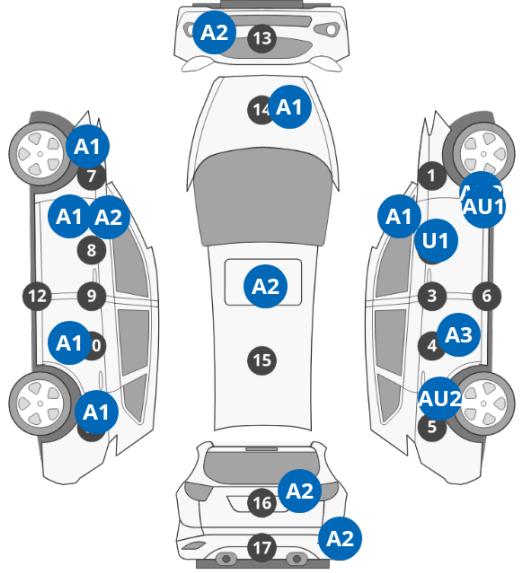
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.2	102	89	101
2	Boot Lid	89.3	89	93	87
3	Roof	79.5	82	85	75/76
4	Left Front Fender	87.5	90	88	85
5	Left Front Door	180.3	183	172	186
6	Center Panel Left				
7	Left Rear Door	96.2	102	94	93
8	Left Back Panel	84.3	81	87	86
9	Right Front Fender	88.8	91	86	90
10	Right Front Door	104.3	108	102	103
11	Center Panel Right				
12	Right Rear Door	108.3	108	103	114
13	Right Back Panel	91.9	91	89	96

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / Ceiling - Crinkle - Small</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight</p>