

General Information

Date & Time: 18, Feb, 2026 10:29

Make	Mitsubishi	Model	Mirage
YOM	2025	Odo Meter Reading	2,338
Registration No.	GBB1868	Chassis No.	PAEA13MJSSA000523
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



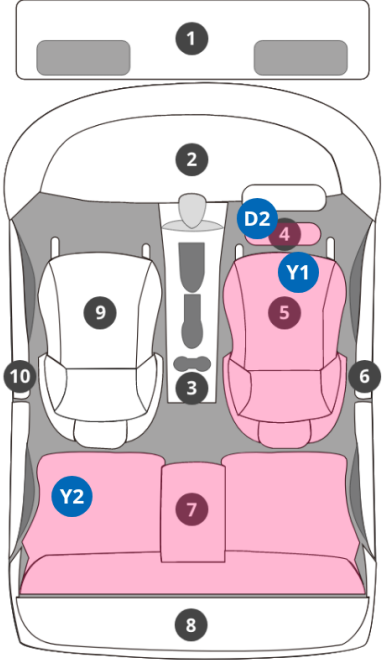
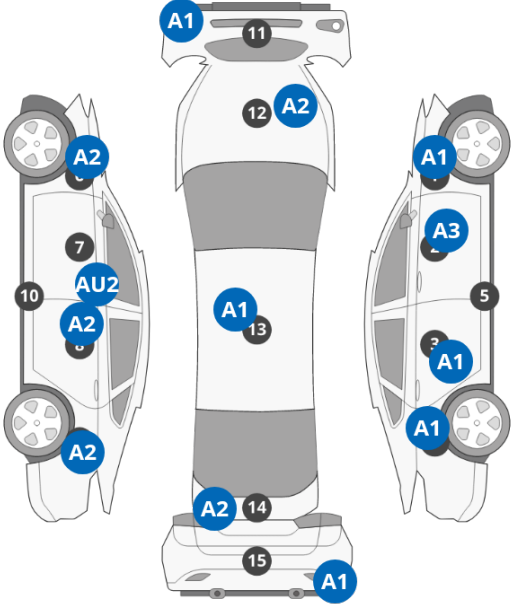
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.0	127	129	131
2	Boot Lid	99.1	95	100	102
3	Roof	107.7	107	113	102/109
4	Left Front Fender	107.6	101	112	110
5	Left Front Door	109.0	111	108	108
6	Center Panel Left				
7	Left Rear Door	104.7	108	107	99
8	Left Back Panel	119.6	124	120	115
9	Right Front Fender	107.6	112	103	108
10	Right Front Door	116.3	116	114	119
11	Center Panel Right				
12	Right Rear Door	113.3	109	113	118
13	Right Back Panel	105.6	106	105	106

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light</p>