

General Information

Date & Time: 13, Feb, 2026 15:09

Make	Kia	Model	Sonet
YOM	2024	Odo Meter Reading	11,736
Registration No.	KBB8935	Chassis No.	LJD3BA1DER0020721
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



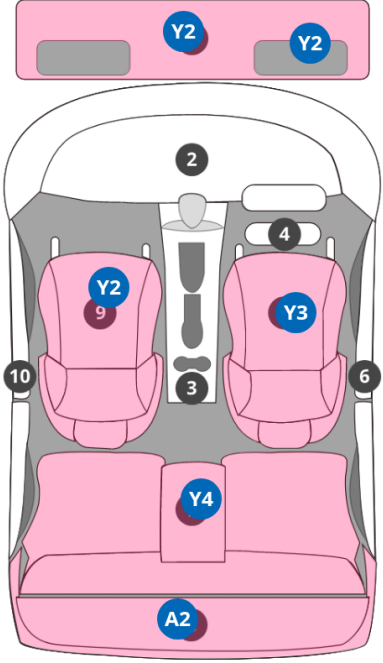
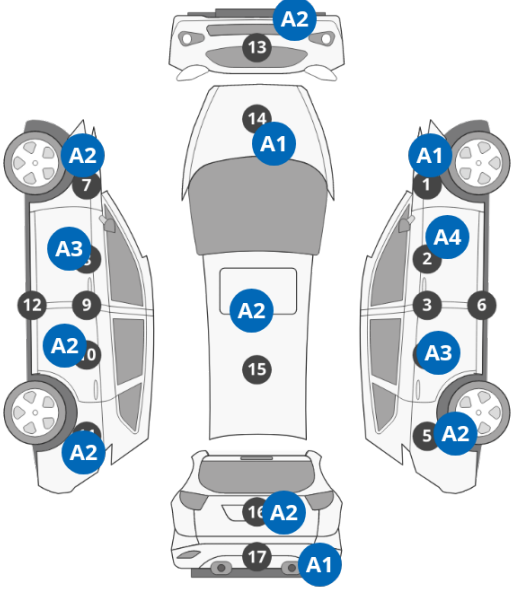
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	128	119	133
2	Boot Lid	96.9	85	103	103
3	Roof	108.2	108	110	110/105
4	Left Front Fender	122.6	119	125	124
5	Left Front Door	126.6	122	128	130
6	Center Panel Left				
7	Left Rear Door	122.6	132	121	115
8	Left Back Panel	120.0	127	125	108
9	Right Front Fender	145.6	150	131	156
10	Right Front Door	486.3	148	1,133	178
11	Center Panel Right				
12	Right Rear Door	127.6	119	127	137
13	Right Back Panel	121.3	123	123	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 2 key/with jack and tools/with reverse camera/No seat cover/with warranty booklet/front windshield issue/</p>