

General Information

Date & Time: 10, Feb, 2026 16:00

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	38,324
Registration No.	GBF9381	Chassis No.	PA2JA8EM8R0150219
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



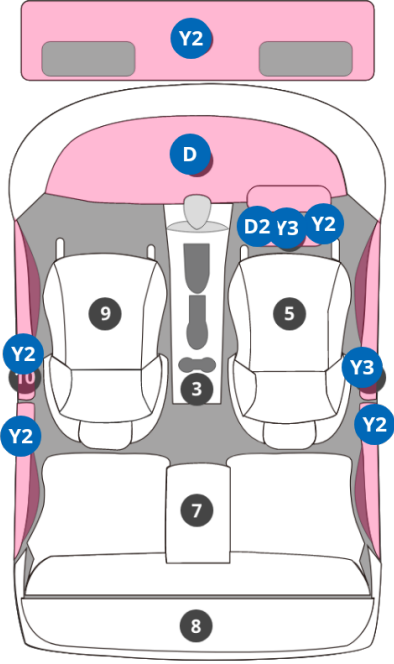
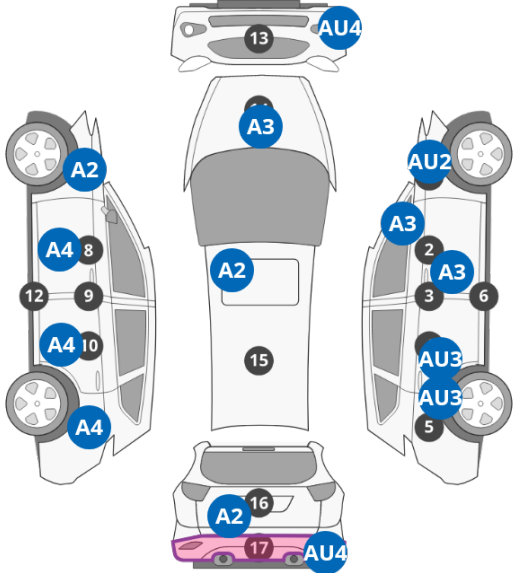
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	99	100	99
2	Boot Lid	93.0	95	91	94
3	Roof	84.6	85	88	81/85
4	Left Front Fender	93.2	100	95	85
5	Left Front Door	97.0	96	95	100
6	Center Panel Left				
7	Left Rear Door	101.3	107	99	99
8	Left Back Panel	107.6	107	111	105
9	Right Front Fender	88.0	81	92	91
10	Right Front Door	97.3	105	94	93
11	Center Panel Right				
12	Right Rear Door	97.8	93	98	103
13	Right Back Panel	101.6	109	100	96

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>Possible floosing. Crack left taillight. Scratches at signal light right side.No warranty booklet. With spare tire, jack, tools. 2 keys. With LTO plate</p>