

General Information

Date & Time: 05, Feb, 2025 17:23

Make	Toyota	Model	Vios
YOM	2021	Mileage	37,325
Registration No.	DAV7116	Chassis No.	PA1B18F35M4149027
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



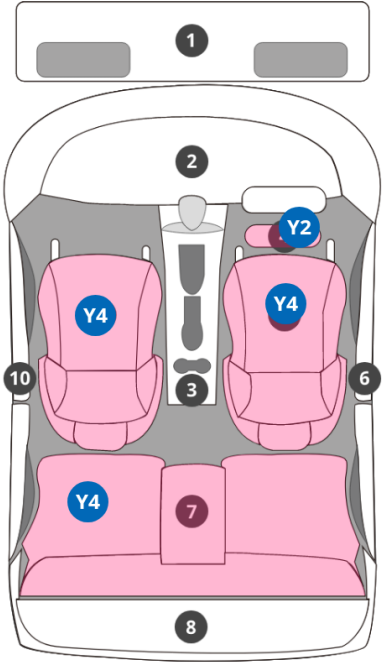
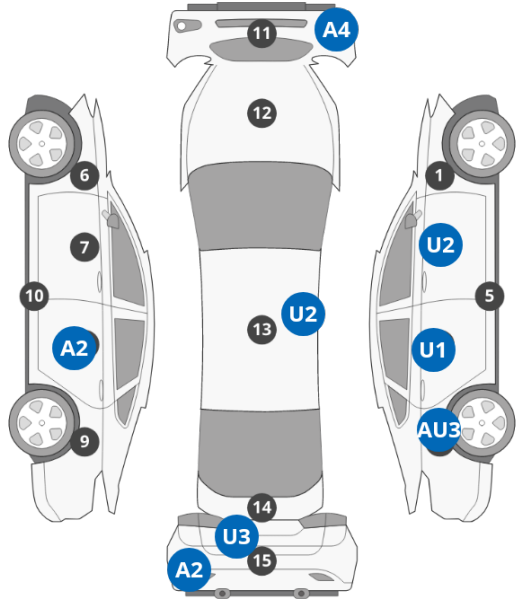
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	108	113	109
2	Boot Lid	115.3	112	104	130
3	Roof	108.5	120	103	101/110
4	Left Front Fender	113.4	97	97	147
5	Left Front Door	99.5	100	97	102
6	Center Panel Left				
7	Left Rear Door	102.9	106	99	104
8	Left Back Panel	113.0	109	127	103
9	Right Front Fender	91.8	90	93	93
10	Right Front Door	104.7	114	101	99
11	Center Panel Right				
12	Right Rear Door	102.2	100	99	108
13	Right Back Panel	105.6	104	107	106

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Large / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large	Remarks Trunk Hood, Rear Gate - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Dent - Small / (R) Rear Door, Molding - Dent - Minimal / (R) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate number/with spare tire/ jack/No reverse camera/ No warranty booklet/No tools/ rear left tail light crack