

General Information

Date & Time: 10, Feb, 2026 13:14

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	89,766
Registration No.	FAP8265	Chassis No.	MHKU3FE10NK001216
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Pickup
Colour	White		

Body / Panel Condition



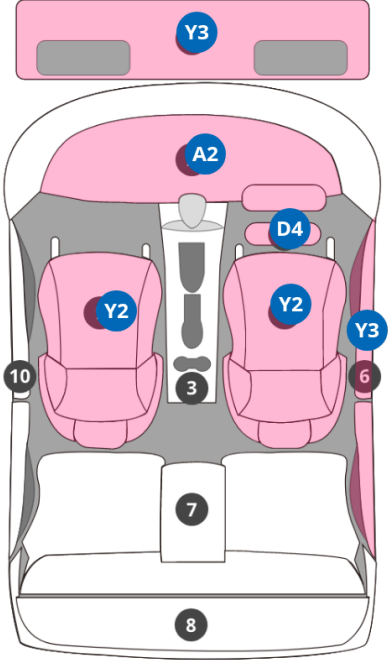
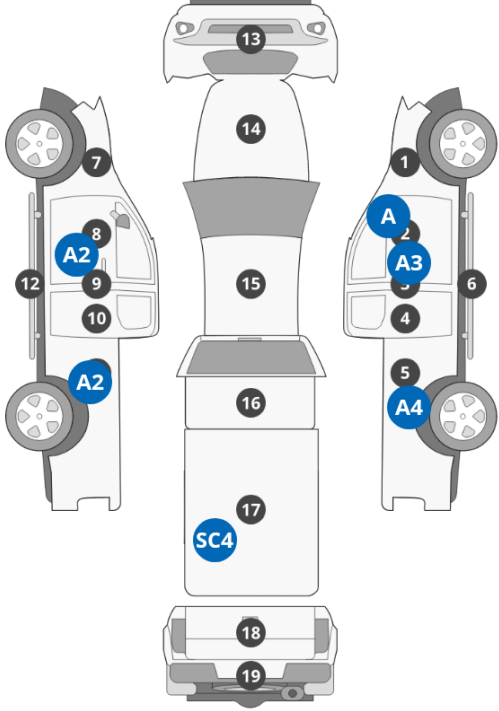
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	50.0	53	51	47
2	Boot Lid	39.0	44	35	38
3	Roof				
4	Left Front Fender	45.1	50	44	42
5	Left Front Door	47.5	46	48	48
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	40.8	41	45	37
9	Right Front Fender	50.0	49	47	54
10	Right Front Door	45.0	40	49	46
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	37.1	34	43	34

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch, Peeled - Yes / (R) Guard Frame - Scratch - Large / (L) Guard Frame - Scratch - Small / Cargo Bed Floor - Rust, Corrosion - Large / Overall Exterior - Worn as per age - Yes / (L) Rear Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with spare tire. no spare key. without jack and tools. no seat cover. no warranty booklet</p>