

General Information

Date & Time: 10, Feb, 2026 06:39

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	15,716
Registration No.	FAS1576	Chassis No.	MHKAA1BA0RJ127907
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



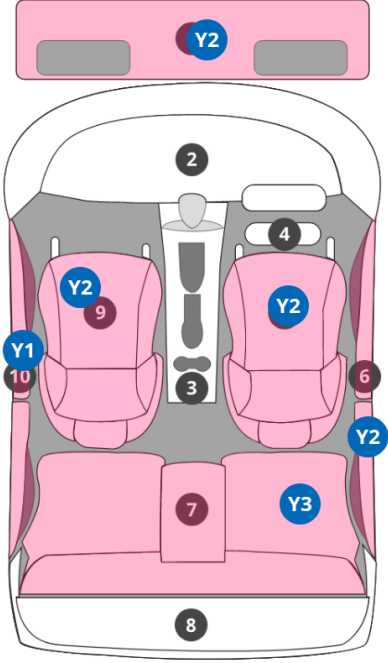
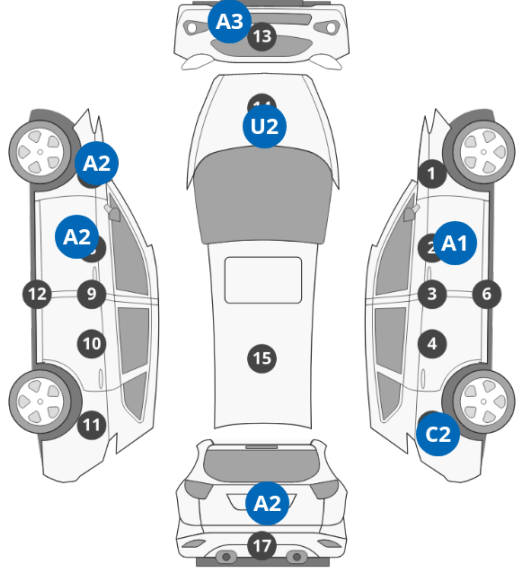
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	86	95	184
2	Boot Lid	619.0	187	1,244	426
3	Roof	79.2	83	84	71/79
4	Left Front Fender	77.5	81	78	74
5	Left Front Door	80.6	79	84	79
6	Center Panel Left				
7	Left Rear Door	80.0	86	78	76
8	Left Back Panel	76.9	77	77	78
9	Right Front Fender	82.5	82	86	80
10	Right Front Door	87.4	85	90	87
11	Center Panel Right				
12	Right Rear Door	82.5	80	80	88
13	Right Back Panel	77.9	73	76	85

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no jack and tools. no warranty booklet. no spare key. no seat cover. with spare tire.</p>