

## General Information

Date & Time: 16, Feb, 2026 09:38

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	42,182
<b>Registration No.</b>	EAJ6590	<b>Chassis No.</b>	PA1B18F39R4272109
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



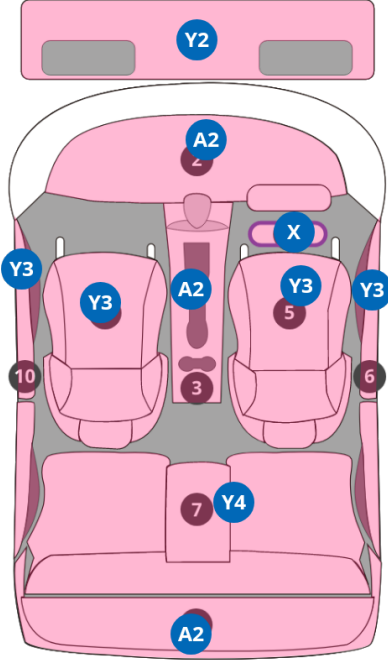
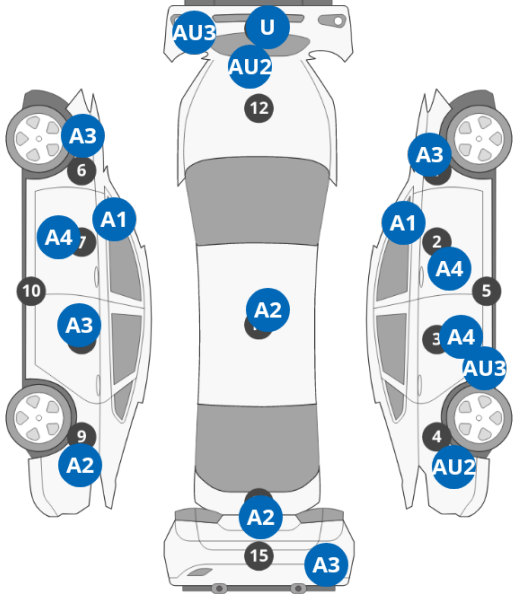
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	189.3	201	184	183
2	Boot Lid	150.3	147	149	155
3	Roof	153.7	164	159	152/140
4	Left Front Fender	155.0	155	157	153
5	Left Front Door	157.6	155	154	164
6	Center Panel Left				
7	Left Rear Door	164.0	173	158	161
8	Left Back Panel	180.0	208	166	166
9	Right Front Fender	163.6	168	163	160
10	Right Front Door	126.6	132	119	129
11	Center Panel Right				
12	Right Rear Door	136.0	138	131	139
13	Right Back Panel	150.0	141	148	161

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / Member (Bolted) - Dent - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/No spare tire/with 1 key/No warranty booklet/with reverse camera/No jack and tools/No seat cover/interior dirty/</p>