


General Information

Date & Time: 04, Feb, 2025 09:38

Make	Toyota	Model	Vios
YOM	2021	Mileage	46,390
Registration No.	CBM2443	Chassis No.	PA1B18F32M4138857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition

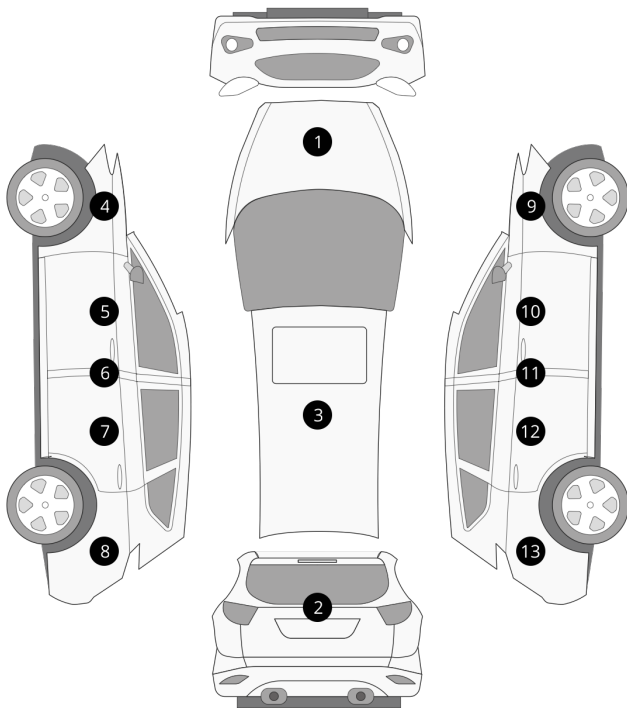


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	103	97	109
2	Boot Lid	111.0	104	100	129
3	Roof	91.2	92	85	91/97
4	Left Front Fender	244.3	214	391	128
5	Left Front Door	93.6	101	95	85
6	Center Panel Left				
7	Left Rear Door	92.3	93	94	90
8	Left Back Panel	98.7	97	93	107
9	Right Front Fender	104.8	89	109	116
10	Right Front Door	133.9	96	89	217
11	Center Panel Right				
12	Right Rear Door	99.5	100	98	101
13	Right Back Panel	96.2	91	94	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

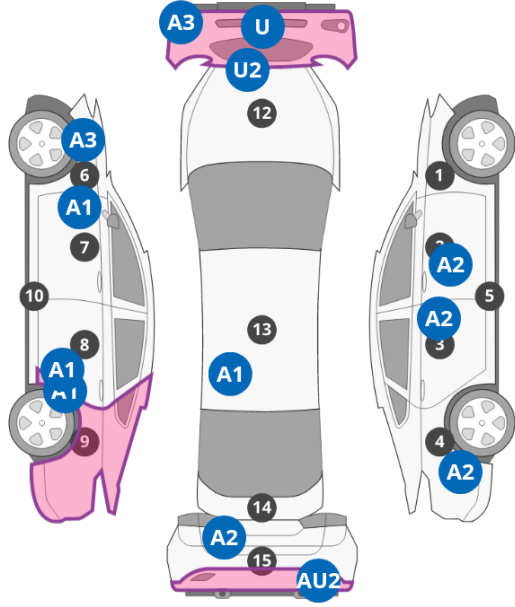Interior Evaluation : B	Exterior Evaluation : C
 No Image a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no sparetire, no tools, with jack, with LTO plate, all floor mat missing, no left plate light