

General Information

Date & Time: 19, Feb, 2026 15:21

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	36,905
Registration No.	NFH9577	Chassis No.	PA1B18F36N4179476
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



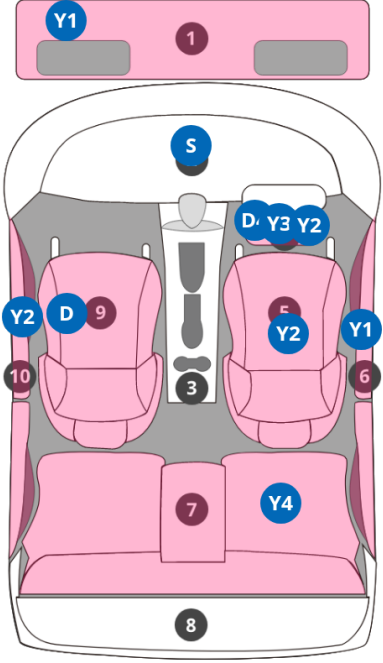
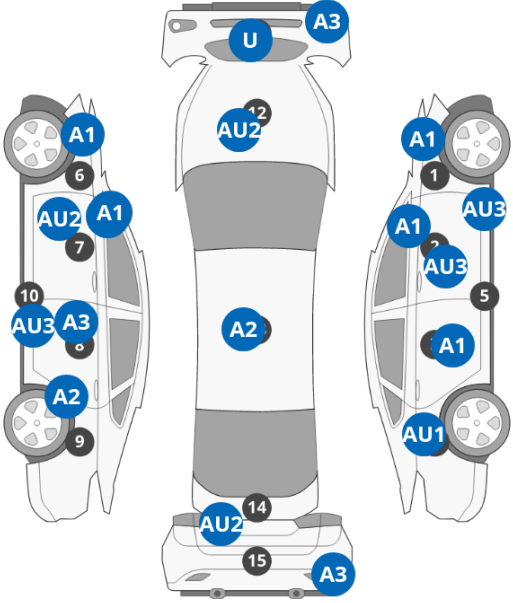
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	115	115	119
2	Boot Lid	117.0	115	108	128
3	Roof	99.4	113	99	90/95
4	Left Front Fender	108.3	115	102	108
5	Left Front Door	106.6	104	112	104
6	Center Panel Left				
7	Left Rear Door	107.6	104	108	111
8	Left Back Panel	118.3	116	131	108
9	Right Front Fender	115.7	99	107	141
10	Right Front Door	108.8	118	111	98
11	Center Panel Right				
12	Right Rear Door	100.6	95	98	109
13	Right Back Panel	117.3	104	106	142

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / Rear Seat - Grime - Large / (L) Front Floor Mat - Worked - Large / Mat Other - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes / (L) Front Trim - Grime - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (L) Mirror - Crack - Damaged / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet and tools, with jack, with spare tire, with LTO plate, scratches on tail light, possible flooding, left side mirror loose</p>