

## General Information

Date & Time: 11, Feb, 2026 13:26

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	37,999
<b>Registration No.</b>	NHU4659	<b>Chassis No.</b>	PA1B18F31R4271827
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



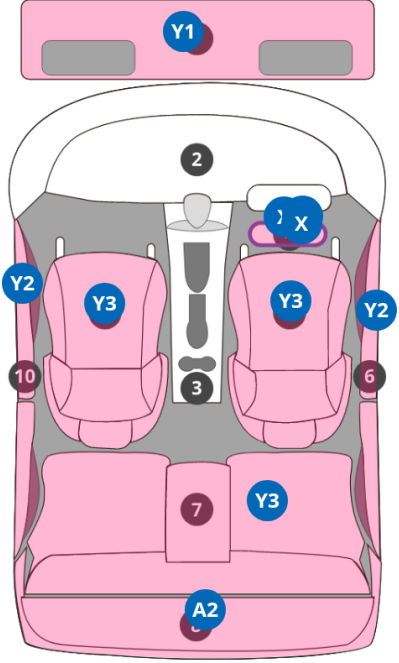
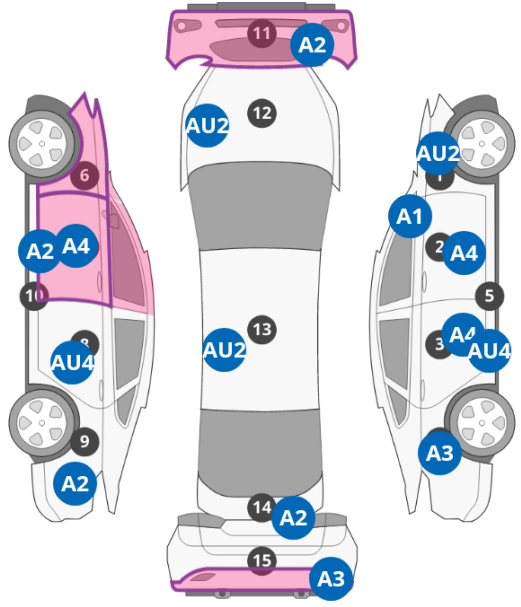
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	111	93	99
2	Boot Lid	99.3	99	99	100
3	Roof	89.7	93	89	88/89
4	Left Front Fender	89.8	87	89	94
5	Left Front Door	96.0	100	100	88
6	Center Panel Left				
7	Left Rear Door	100.5	104	100	98
8	Left Back Panel	102.0	103	102	101
9	Right Front Fender	95.5	94	96	98
10	Right Front Door	94.4	94	95	95
11	Center Panel Right				
12	Right Rear Door	96.1	99	93	96
13	Right Back Panel	96.5	90	95	105

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack No tools/with 1 key/No seat cover/No warranty booklet/reverse camera not working/front and rear floor mat missing/dome light issue front left fender traces of repair/front and rear bumper traces of repair/front left side door traces of repair /head units issue/aircon issue</p>