

General Information

Date & Time: 16, Feb, 2026 09:37

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	116,925
Registration No.	NID3998	Chassis No.	PA1B18F33N4185803
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



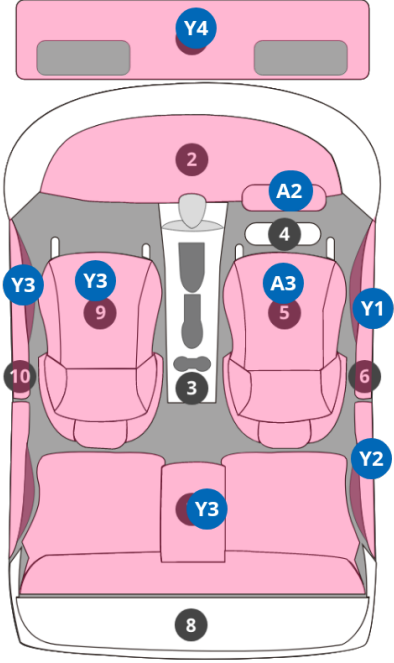
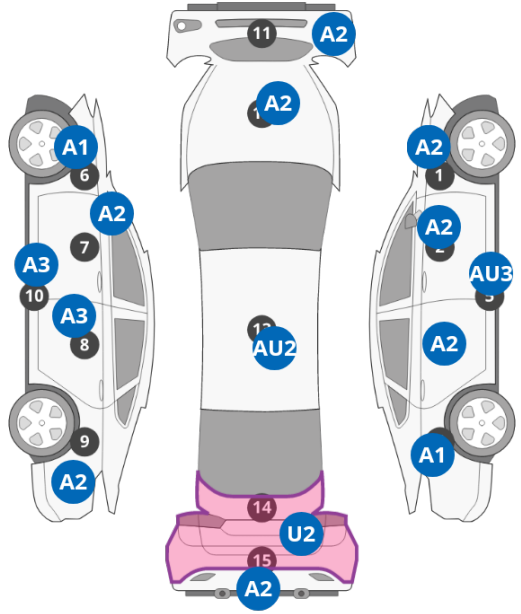
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	300.6	169	549	184
2	Boot Lid	942.6	1,192	701	935
3	Roof	104.6	121	108	101/88
4	Left Front Fender	141.3	146	140	138
5	Left Front Door	126.0	125	123	130
6	Center Panel Left				
7	Left Rear Door	125.6	125	124	128
8	Left Back Panel	149.6	134	154	161
9	Right Front Fender	118.0	125	116	113
10	Right Front Door	94.8	96	90	98
11	Center Panel Right				
12	Right Rear Door	87.6	80	87	96
13	Right Back Panel	118.3	142	111	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Cut, Crack - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/with reverse camera/with warranty booklet/park lights issue/plate light issue/rear seat issue/possibleflooding/No seat cover /trunk room traces of welding/left side mirror issue/bonnet ho9d traces of welding</p>