

General Information

Date & Time: 02, Feb, 2025 16:23

Make	Toyota	Model	Wigo
YOM	2021	Mileage	36,187
Registration No.	EAE5204	Chassis No.	MHKA4DF5FMJ059391
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



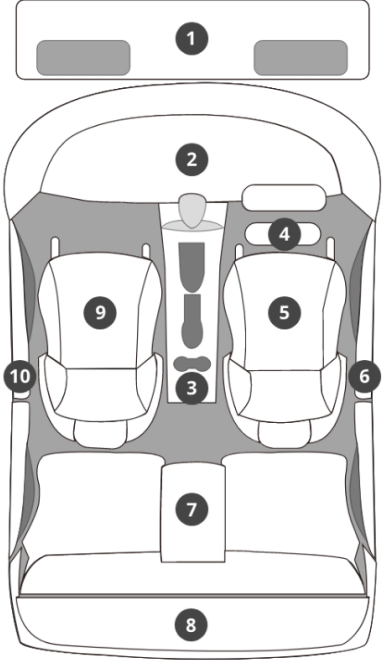
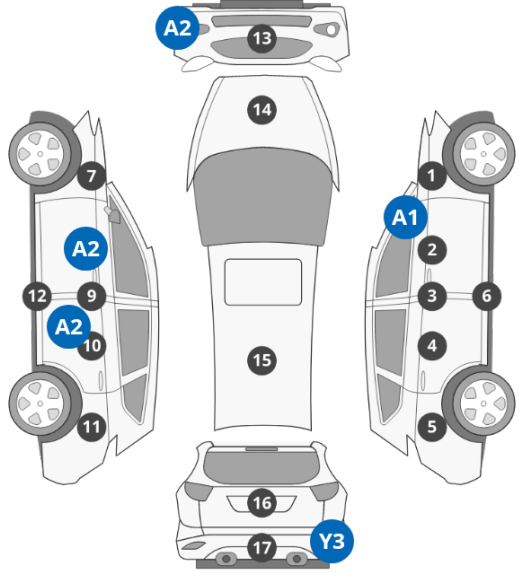
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.3	87	91	90
2	Boot Lid	97.5	96	100	97
3	Roof	79.1	73	81	83/80
4	Left Front Fender	104.0	106	106	100
5	Left Front Door	91.7	86	87	102
6	Center Panel Left				
7	Left Rear Door	91.2	91	89	94
8	Left Back Panel	98.2	97	94	104
9	Right Front Fender	164.0	184	148	160
10	Right Front Door	146.0	157	138	143
11	Center Panel Right				
12	Right Rear Door	149.0	152	158	137
13	Right Back Panel	499.0	1,140	201	156

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with spare tire and incomplete tools, with jack, with LTO plate/ uneven worn of tires/