

General Information

Date & Time: 10, Feb, 2026 17:55

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	5,796
Registration No.	NKQ8846	Chassis No.	MHFAA1BY8S0042742
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



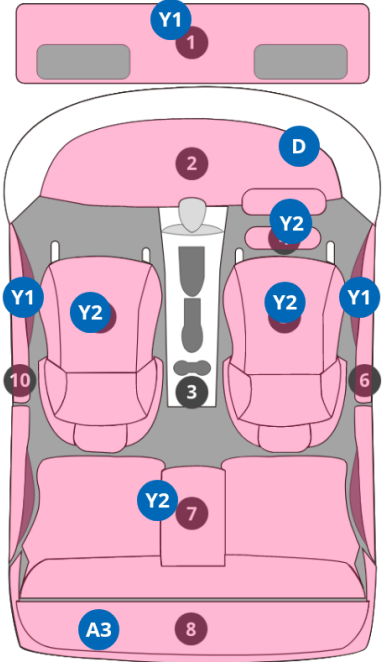
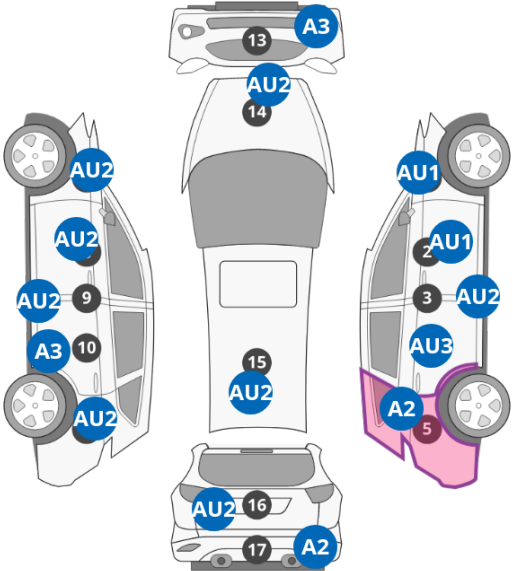
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.8	108	98	106
2	Boot Lid	117.0	117	113	121
3	Roof	123.2	125	125	110/133
4	Left Front Fender	108.3	103	121	101
5	Left Front Door	120.0	110	121	129
6	Center Panel Left				
7	Left Rear Door	119.6	122	110	127
8	Left Back Panel	122.3	130	114	123
9	Right Front Fender	116.6	136	105	109
10	Right Front Door	112.0	119	109	108
11	Center Panel Right				
12	Right Rear Door	113.0	114	102	123
13	Right Back Panel	275.6	182	468	177

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with reverse camera, with manual and warranty booklet ,no spare key, scratches on taillight and headlight.</p>