

General Information

Date & Time: 05, Feb, 2025 15:20

Make	Toyota	Model	Wigo
YOM	2021	Mileage	29,666
Registration No.	NGO5348	Chassis No.	MHKA4DF5FLJ046874
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



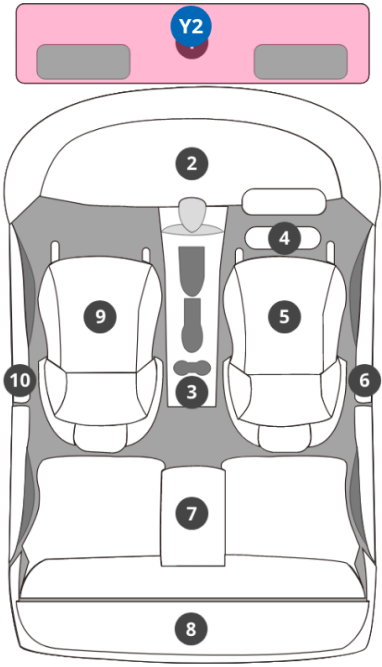
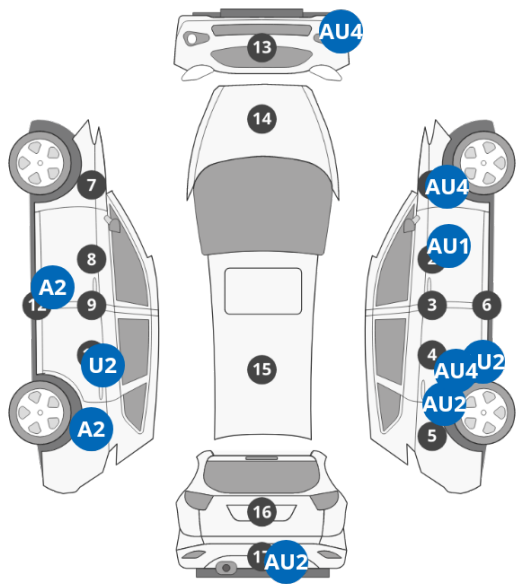
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	114	110	87
2	Boot Lid	107.6	101	114	108
3	Roof	93.6	83	99	102/91
4	Left Front Fender	89.6	81	92	95
5	Left Front Door	93.2	93	97	90
6	Center Panel Left				
7	Left Rear Door	91.7	89	92	94
8	Left Back Panel	102.8	96	131	81
9	Right Front Fender	114.6	100	109	135
10	Right Front Door	89.3	85	94	89
11	Center Panel Right				
12	Right Rear Door	91.6	94	88	93
13	Right Back Panel	102.4	108	108	91

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and incomplete, with spare tire, with LTO plate, front right door stuck up, both front tires worn