

General Information

Date & Time: 14, Feb, 2026 16:04

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	8,267
Registration No.	CCA2608	Chassis No.	PA1B18F35P4217427
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



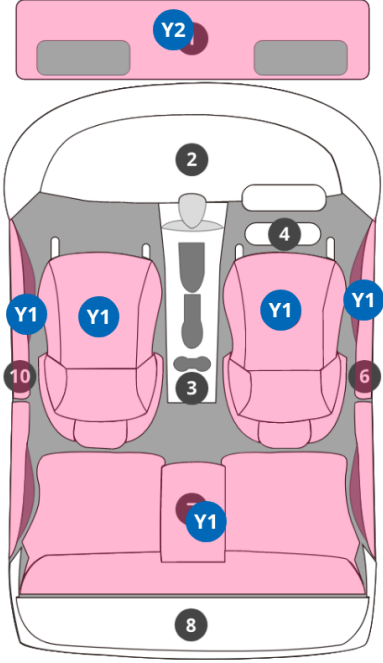
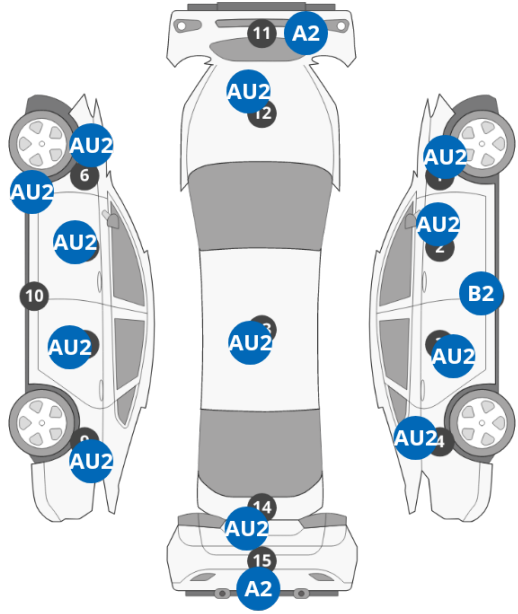
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.2	99	127	98
2	Boot Lid	117.3	109	119	124
3	Roof	110.0	121	112	107/100
4	Left Front Fender	102.6	105	102	101
5	Left Front Door	103.4	103	99	108
6	Center Panel Left				
7	Left Rear Door	102.2	110	100	97
8	Left Back Panel	110.6	112	107	113
9	Right Front Fender	107.3	108	108	106
10	Right Front Door	103.5	116	96	99
11	Center Panel Right				
12	Right Rear Door	105.6	101	114	102
13	Right Back Panel	101.0	101	97	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Modified - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with warranty booklet, with spare key, with jack, no tools, horn issue, scratches on taillight and headlight.</p>