

General Information

Date & Time: 13, Feb, 2026 13:59

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	69,639
Registration No.	BAE8532	Chassis No.	MHKA4DF5FMJ057211
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



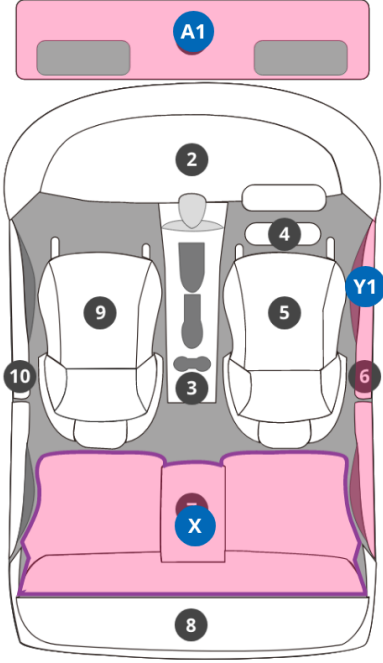
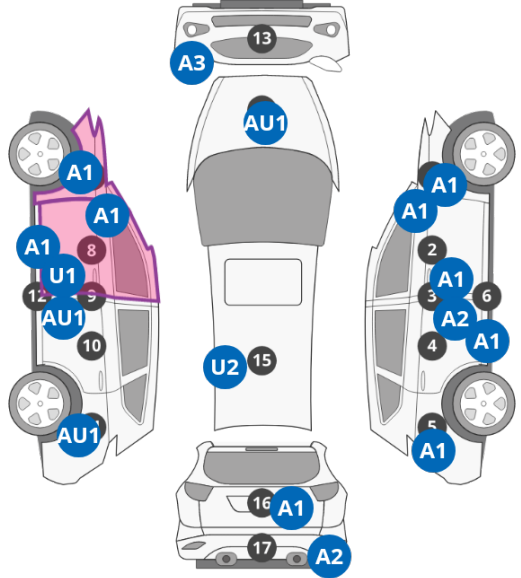
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.1	80	89	71
2	Boot Lid	86.9	80	97	84
3	Roof	70.7	59	77	72/75
4	Left Front Fender	98.9	102	106	89
5	Left Front Door	98.7	94	102	100
6	Center Panel Left				
7	Left Rear Door	73.3	74	74	72
8	Left Back Panel	71.5	75	70	70
9	Right Front Fender	79.8	82	83	75
10	Right Front Door	77.8	78	81	75
11	Center Panel Right				
12	Right Rear Door	76.0	78	78	72
13	Right Back Panel	77.5	78	73	82

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat Head Rest - Partially Missing - Yes / (R) Front Trim - Grime - Minimal / Ceiling - Cut, Crack - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, 1key, no jack and tools, scratches on headlights and taillights</p>