

## General Information

Date & Time: 14, Feb, 2026 16:02

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	35,352
<b>Registration No.</b>	NIQ8417	<b>Chassis No.</b>	MHKAA1BC8PJ008372
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Yellow		

## Body / Panel Condition



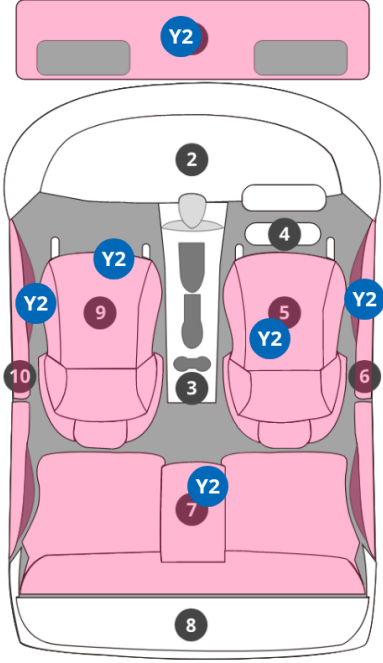
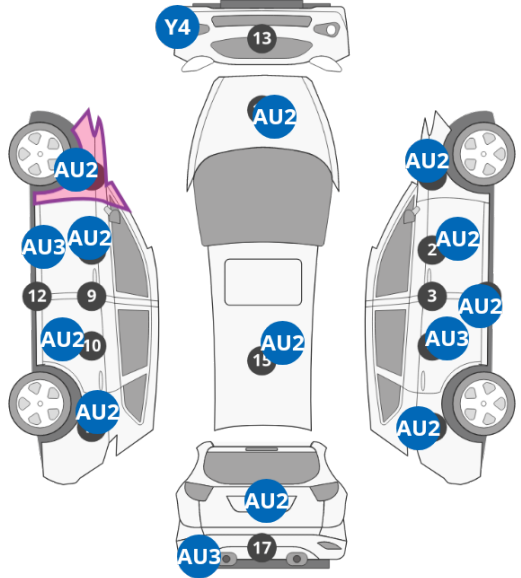
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	121	113	122
2	Boot Lid	98.5	99	99	97
3	Roof	101.6	96	90	106/115
4	Left Front Fender	163.3	195	157	138
5	Left Front Door	115.0	112	114	119
6	Center Panel Left				
7	Left Rear Door	106.5	120	104	96
8	Left Back Panel	99.9	101	99	100
9	Right Front Fender	109.6	115	110	104
10	Right Front Door	109.6	112	108	109
11	Center Panel Right				
12	Right Rear Door	109.3	115	100	113
13	Right Back Panel	103.3	107	104	99

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire with warranty booklet, with reverse camera, with jack, no spare key, scratches on headlight, issue on taillight lens right side. remote key issue.</p>