

General Information

Date & Time: 13, Feb, 2026 15:05

Make	Toyota	Model	Innova
YOM	2020	Odo Meter Reading	151,481
Registration No.	DBA7041	Chassis No.	PA2JA8EMXL008074
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



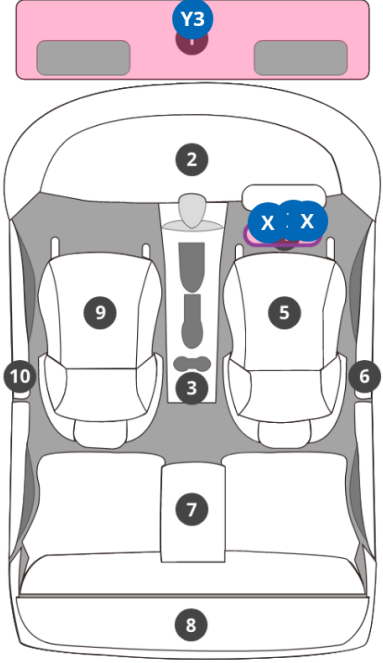
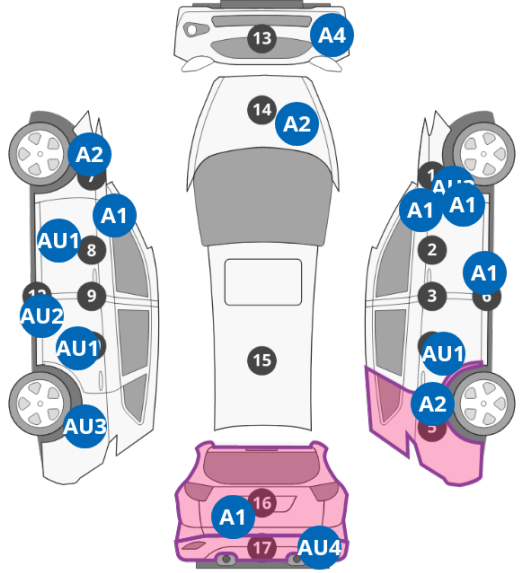
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	113	111	105
2	Boot Lid	123.3	114	124	132
3	Roof	97.4	92	98	77/123
4	Left Front Fender	98.0	99	100	95
5	Left Front Door	99.8	97	107	95
6	Center Panel Left				
7	Left Rear Door	101.8	103	100	103
8	Left Back Panel	106.3	103	105	111
9	Right Front Fender	109.3	99	104	125
10	Right Front Door	97.7	92	105	97
11	Center Panel Right				
12	Right Rear Door	96.3	92	97	100
13	Right Back Panel	125.2	147	139	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Medium	Remarks (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch, Peeled - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, no tools, 1key, scratches on headlights and taillights, battery weak, warning lamp on