

General Information

Date & Time: 14, Feb, 2026 15:58

Make	Toyota	Model	Corolla Altis
YOM	2016	Odo Meter Reading	68,064
Registration No.	NDT5958	Chassis No.	MR053REH104545795
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



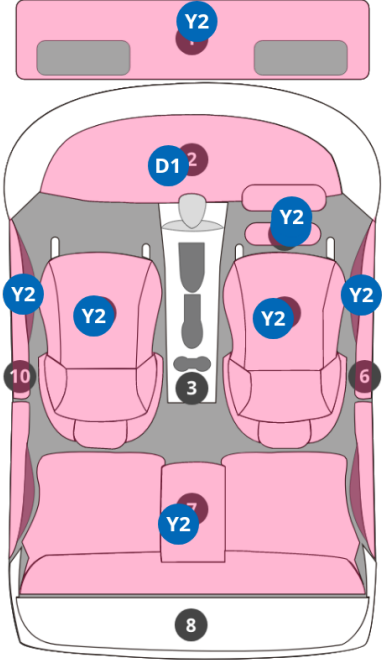
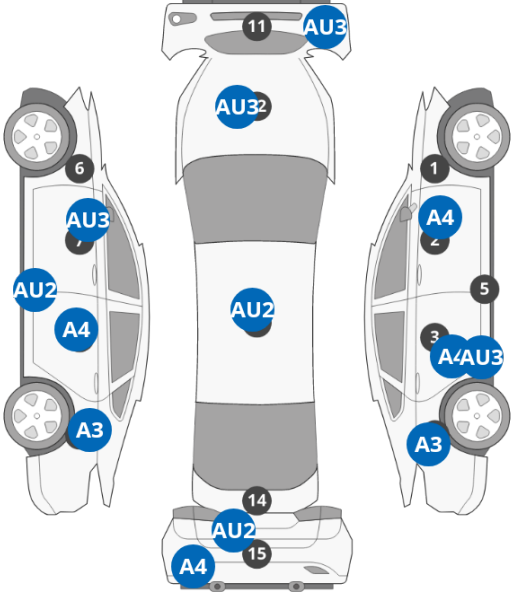
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	120	102	116
2	Boot Lid	112.1	97	123	116
3	Roof	92.1	98	89	88/93
4	Left Front Fender	98.0	102	97	95
5	Left Front Door	153.3	139	146	175
6	Center Panel Left				
7	Left Rear Door	164.0	185	147	160
8	Left Back Panel	161.6	156	141	188
9	Right Front Fender	103.2	109	99	102
10	Right Front Door	135.2	159	149	98
11	Center Panel Right				
12	Right Rear Door	139.3	154	128	136
13	Right Back Panel	116.4	107	98	144

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worked - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with reverse camera, with spare tire, no tools, no jack, no spare key, no manual and warranty booklet, scratches on taillight and headlight,.</p>