

General Information

Date & Time: 16, Feb, 2026 08:53

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,775
Registration No.	GBJ8152	Chassis No.	PA1B18F37S4286712
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



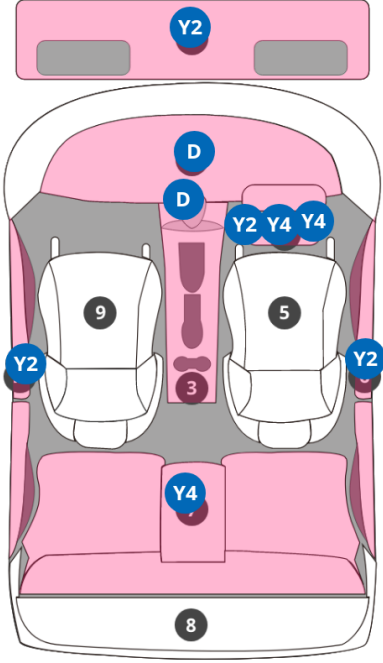
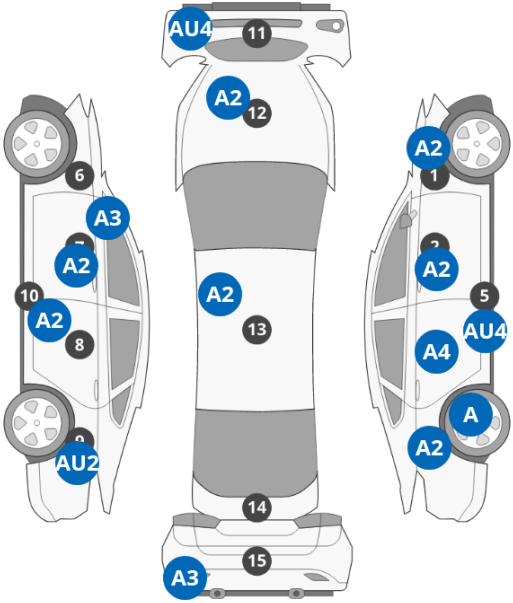
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	113	113	113
2	Boot Lid	107.5	108	100	115
3	Roof	101.5	104	95	107/100
4	Left Front Fender	100.6	102	100	100
5	Left Front Door	125.6	167	100	110
6	Center Panel Left				
7	Left Rear Door	104.5	108	106	100
8	Left Back Panel	113.3	118	115	107
9	Right Front Fender	102.3	103	100	104
10	Right Front Door	101.9	109	101	96
11	Center Panel Right				
12	Right Rear Door	104.3	98	100	115
13	Right Back Panel	103.6	105	102	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Mat Other - Grime - Large / Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (R) Rear Tyre - Crack, Cut - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>Punctured rear right tire. Unusual sound at the exhaust area. Fog light cover issue and Foglight loose. Door lock switch not working. Gap at front bumper, front left door and rear bumper. Scratches at headlight and taillight. Adhesive mark at left side mirror. With warranty booklet, spare tire and jack. Without tools. Incomplete seat cover. 2 keys. With LTO plate.</p>