

## General Information

Date & Time: 19, Feb, 2026 10:27

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	5,983
<b>Registration No.</b>	GBK4309	<b>Chassis No.</b>	PA1B18F38S4290736
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



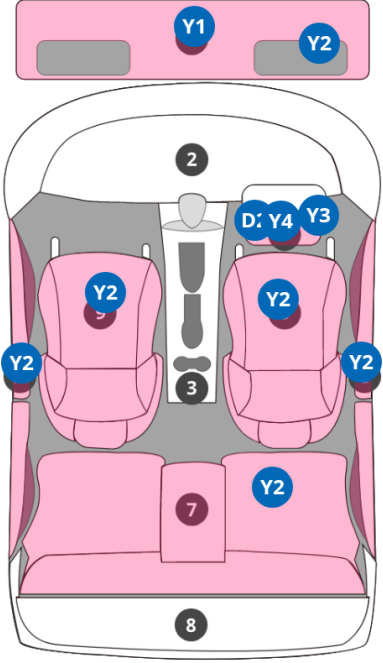
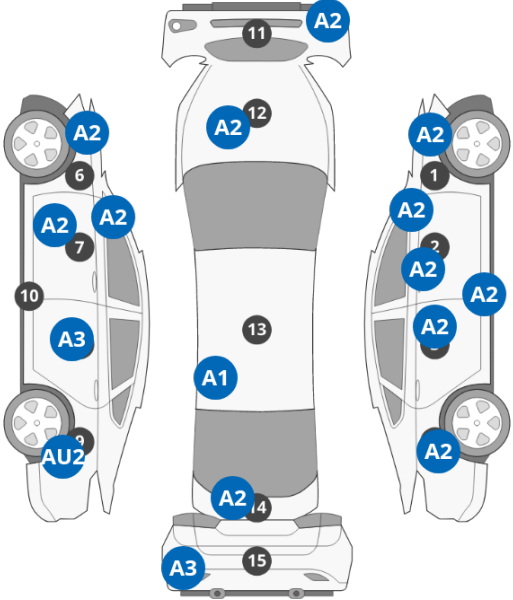
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	112	110	112
2	Boot Lid	101.1	97	97	109
3	Roof	101.3	103	104	99/100
4	Left Front Fender	94.0	94	97	92
5	Left Front Door	99.8	99	100	101
6	Center Panel Left				
7	Left Rear Door	101.2	109	99	96
8	Left Back Panel	109.0	114	111	102
9	Right Front Fender	101.7	105	95	105
10	Right Front Door	98.5	100	102	94
11	Center Panel Right				
12	Right Rear Door	100.5	102	99	101
13	Right Back Panel	106.3	103	104	112

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Mat Other - Grime - Large / Ceiling - Grime - Minimal / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Rusted seat railings. Small Grime at Front right carpet. Scratches on headlight, taillight and front windshield. With warranty booklet, spare tire and jack. Incomplete tools. Without seat cover. 1 key. No LTO plate.</p>