

General Information

Date & Time: 18, Feb, 2026 09:00

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	98,902
Registration No.	DAS6794	Chassis No.	PA1B18F32N4194134
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



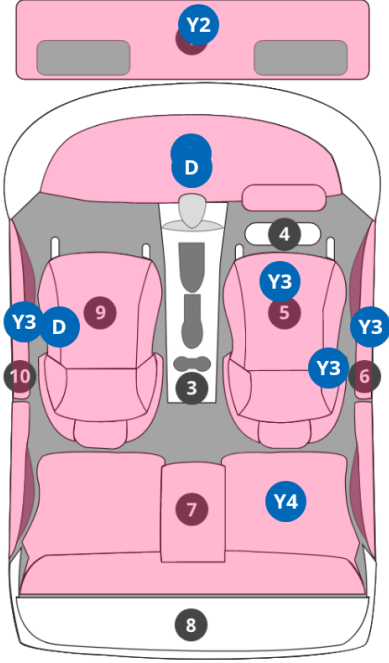
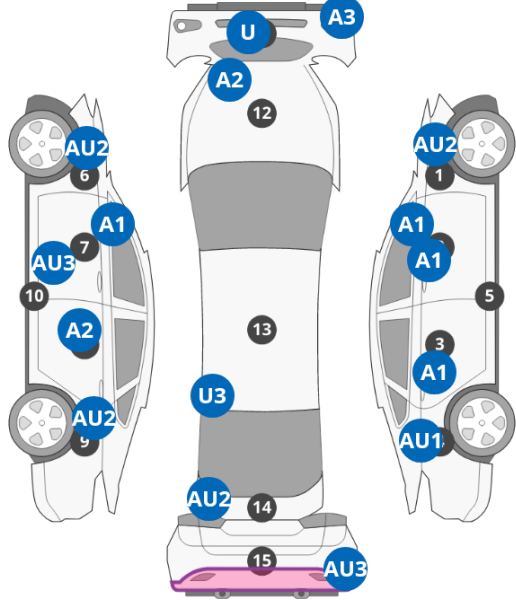
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	115	106	118
2	Boot Lid	108.3	108	100	117
3	Roof	93.8	95	89	91/100
4	Left Front Fender	96.4	94	101	95
5	Left Front Door	99.7	94	102	103
6	Center Panel Left				
7	Left Rear Door	102.8	105	105	99
8	Left Back Panel	211.0	231	251	151
9	Right Front Fender	108.3	111	106	108
10	Right Front Door	105.0	102	104	109
11	Center Panel Right				
12	Right Rear Door	104.0	107	105	100
13	Right Back Panel	103.1	107	98	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Seat belt - Grime - Medium / Rear Seat - Grime - Large / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light and headlight</p>