

General Information

Date & Time: 05, Feb, 2025 18:33

Make	Toyota	Model	Wigo
YOM	2022	Mileage	48,178
Registration No.	EAE5206	Chassis No.	MHKA4DF5FMJ061304
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



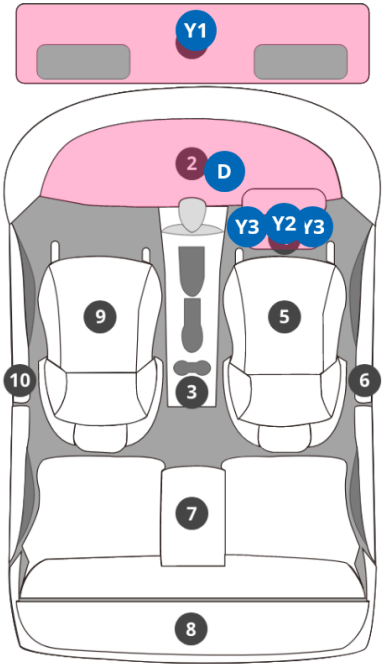
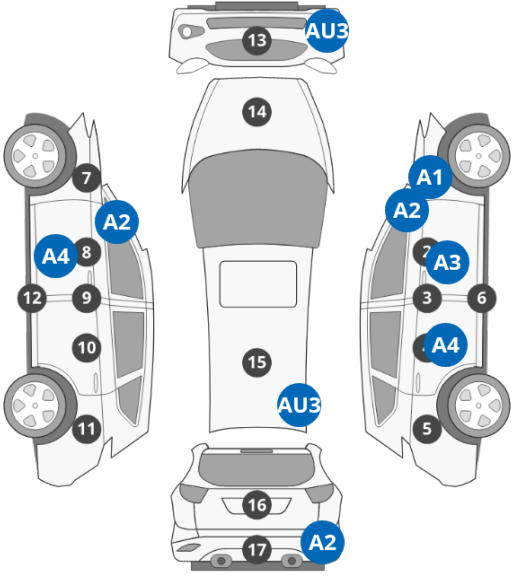
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.7	77	83	73
2	Boot Lid	86.0	85	88	86
3	Roof	68.5	58	73	70/73
4	Left Front Fender	76.7	75	78	77
5	Left Front Door	76.1	75	79	74
6	Center Panel Left				
7	Left Rear Door	76.4	77	75	77
8	Left Back Panel	70.8	68	73	71
9	Right Front Fender	78.4	78	81	77
10	Right Front Door	77.8	79	78	76
11	Center Panel Right				
12	Right Rear Door	75.9	75	76	78
13	Right Back Panel	70.5	71	72	69

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Floor Mat - Grime - Medium	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / Roof - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, spare tire, jack and tools. with LTO plate. grime at the rear right carpet.