

General Information

Date & Time: 16, Feb, 2026 15:32

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	128,563
Registration No.	DBG7560	Chassis No.	PA1B18F32P4202657
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



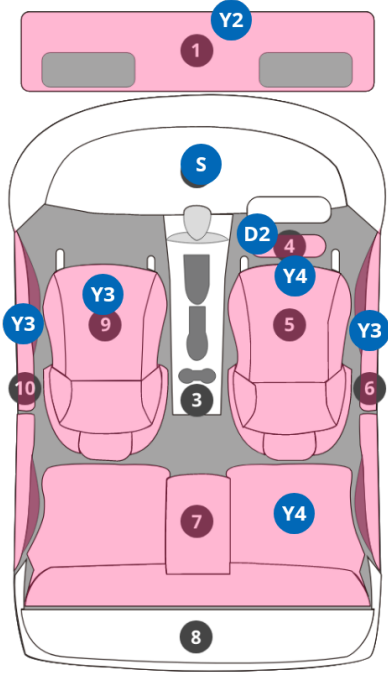
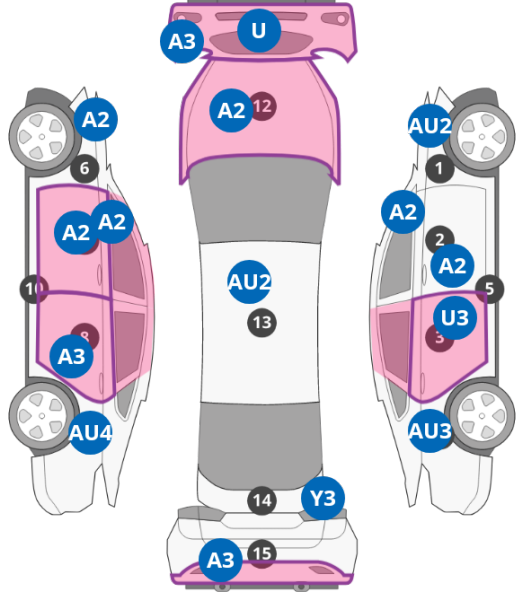
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	179.0	180	193	164
2	Boot Lid	118.3	119	111	125
3	Roof	100.7	101	100	100/102
4	Left Front Fender	106.3	101	110	108
5	Left Front Door	146.3	147	148	144
6	Center Panel Left				
7	Left Rear Door	195.3	201	208	177
8	Left Back Panel	214.3	227	268	148
9	Right Front Fender	234.0	151	250	301
10	Right Front Door	119.0	131	121	105
11	Center Panel Right				
12	Right Rear Door	105.3	104	103	109
13	Right Back Panel	110.6	112	103	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Re-Paint Uneven - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>