

## General Information

Date & Time: 16, Feb, 2026 15:06

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	28,935
<b>Registration No.</b>	NFO2070	<b>Chassis No.</b>	MHKA4DF5FNJ072569
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



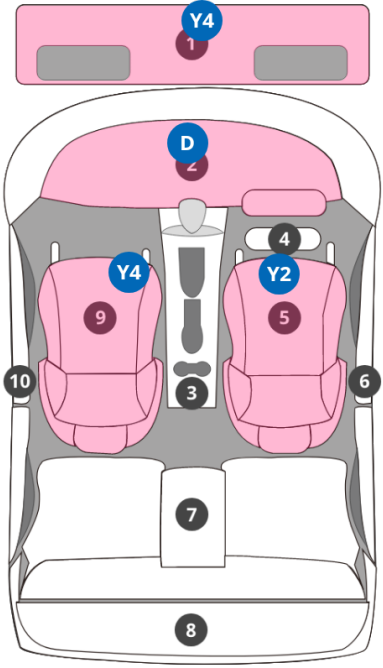
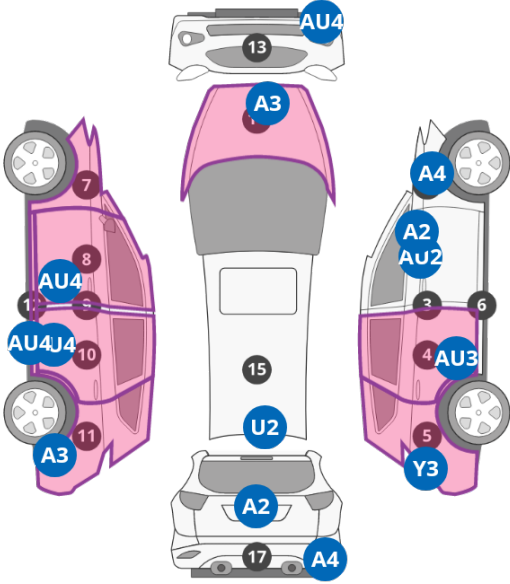
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.8	94	100	100
2	Boot Lid	106.0	104	108	106
3	Roof	81.2	72	83	84/86
4	Left Front Fender	191.3	214	176	184
5	Left Front Door	176.0	150	236	142
6	Center Panel Left				
7	Left Rear Door	182.3	198	171	178
8	Left Back Panel	97.0	97	104	90
9	Right Front Fender	103.3	110	104	96
10	Right Front Door	105.0	98	111	106
11	Center Panel Right				
12	Right Rear Door	174.0	165	179	178
13	Right Back Panel	108.6	115	101	110

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Large / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Crack, Gap - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Small / Roof Spoiler, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet/ no tools/ with jack and spare tire/ with LTO plate/</p>