

General Information

Date & Time: 18, Feb, 2026 15:31

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	12,941
Registration No.	NKL4787	Chassis No.	PA1B18F33R4260810
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



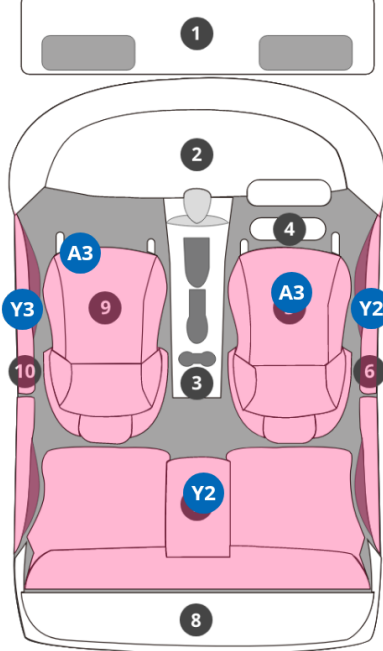
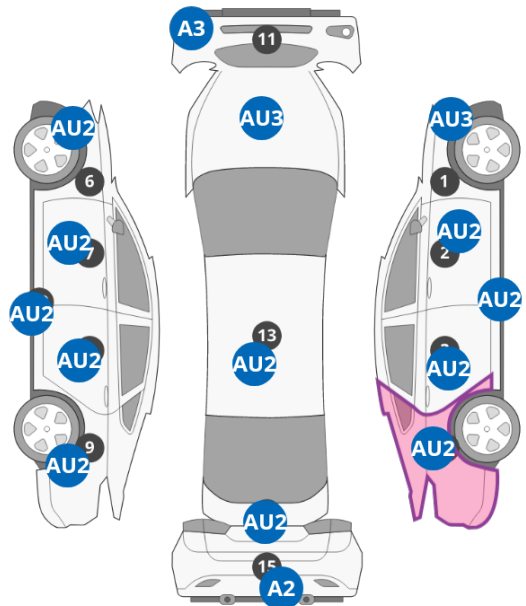
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	97	100	111
2	Boot Lid	106.5	97	100	123
3	Roof	98.9	99	90	82/124
4	Left Front Fender	96.5	103	93	94
5	Left Front Door	116.1	97	103	148
6	Center Panel Left				
7	Left Rear Door	96.7	96	95	100
8	Left Back Panel	100.3	104	105	92
9	Right Front Fender	102.5	109	100	99
10	Right Front Door	91.7	88	95	92
11	Center Panel Right				
12	Right Rear Door	485.3	992	260	204
13	Right Back Panel	288.0	213	216	435

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty and manual booklet, with reverse camera, with spare tire, with jack, issue on taillight lens, no spare key, scratches on headlight.</p>