

General Information

Date & Time: 19, Feb, 2026 13:53

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	41,651
Registration No.	NGY2640	Chassis No.	PA1B18F38M4138944
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



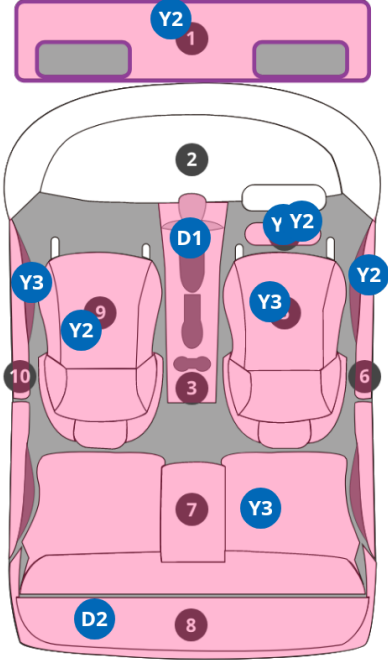
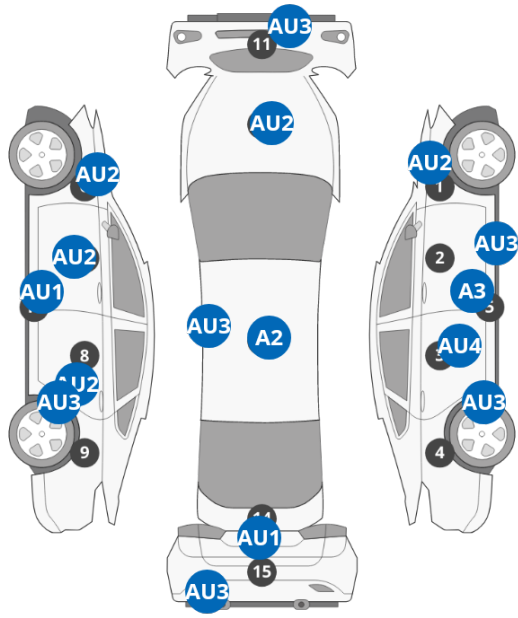
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	113	102	113
2	Boot Lid	122.3	122	110	135
3	Roof	105.7	103	100	105/115
4	Left Front Fender	101.8	103	103	100
5	Left Front Door	106.3	106	106	107
6	Center Panel Left				
7	Left Rear Door	102.6	104	103	101
8	Left Back Panel	111.0	118	105	110
9	Right Front Fender	117.0	123	117	111
10	Right Front Door	121.3	119	119	126
11	Center Panel Right				
12	Right Rear Door	116.6	110	114	126
13	Right Back Panel	118.0	113	110	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Console, Switchs, Vents - Worked - Minimal / Ceiling - Grime - Small / Trunk Room - Loose, Deformed - Small / Room Lamp - Missing - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Roof Spoiler, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack ,with manual and warranty booklet, with spare key, scratches on taillight and headlight, issue on reverse light, no reverse camera.</p>