

General Information

Date & Time: 02, Feb, 2025 10:15

Make	Toyota	Model	Vios
YOM	2022	Mileage	32,888
Registration No.	NFE3596	Chassis No.	PA1B18F32N4182603
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



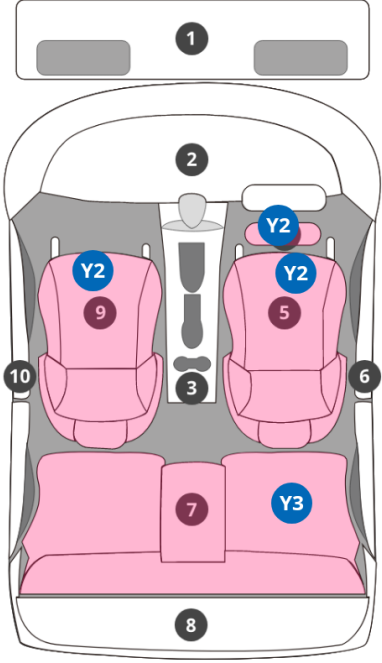
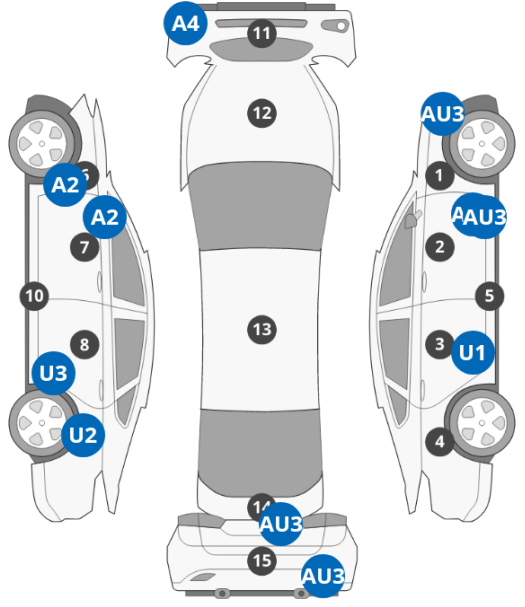
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	105	109	109
2	Boot Lid	113.0	111	112	116
3	Roof	101.6	104	107	101/95
4	Left Front Fender	97.5	98	93	101
5	Left Front Door	109.3	105	111	112
6	Center Panel Left				
7	Left Rear Door	106.6	115	103	102
8	Left Back Panel	109.6	118	109	102
9	Right Front Fender	93.2	106	82	91
10	Right Front Door	102.4	99	105	103
11	Center Panel Right				
12	Right Rear Door	130.0	162	114	114
13	Right Back Panel	105.3	101	101	114

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate number/spare tire/jack/incomplete tools/No warranty booklet/No reverse camera/worn tires