

General Information

Date & Time: 18, Feb, 2026 15:37

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	30,001
Registration No.	DBH8943	Chassis No.	PA1B18F31P4211950
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



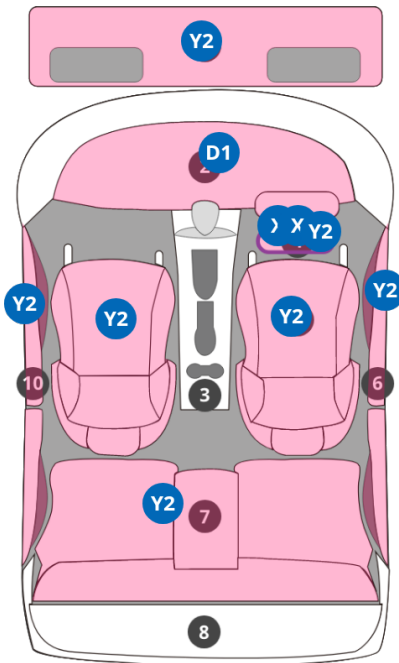
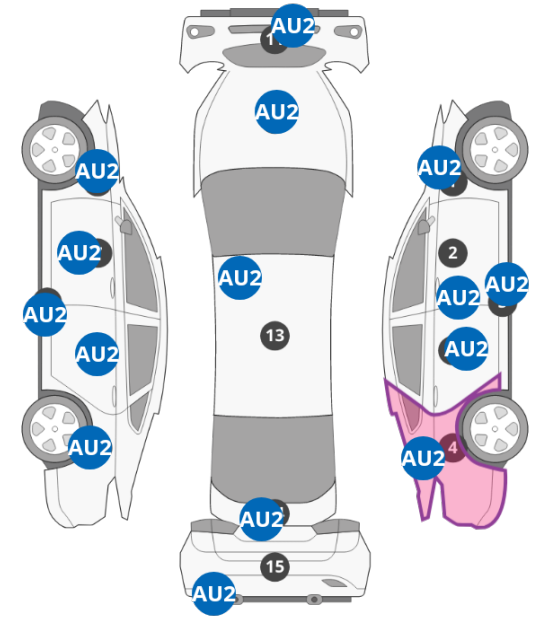
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	167.3	157	168	177
2	Boot Lid	116.6	115	107	128
3	Roof	100.3	104	97	104/96
4	Left Front Fender	102.6	107	105	96
5	Left Front Door	100.2	104	98	98
6	Center Panel Left				
7	Left Rear Door	99.3	101	95	102
8	Left Back Panel	105.3	102	111	103
9	Right Front Fender	105.0	112	103	100
10	Right Front Door	101.6	94	100	111
11	Center Panel Right				
12	Right Rear Door	106.1	100	113	106
13	Right Back Panel	153.3	164	151	145

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worked - Minimal	Remarks Bonnet - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with inc tools and jack, with warranty and manual booklet, no spare key, scratches on taillight and headlight.