

General Information

Date & Time: 16, Feb, 2026 15:23

Make	Toyota	Model	Rush
YOM	2022	Odo Meter Reading	116,699
Registration No.	NGY7706	Chassis No.	MHKE8FF3PNK042075
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Blackish Red Mica		

Body / Panel Condition



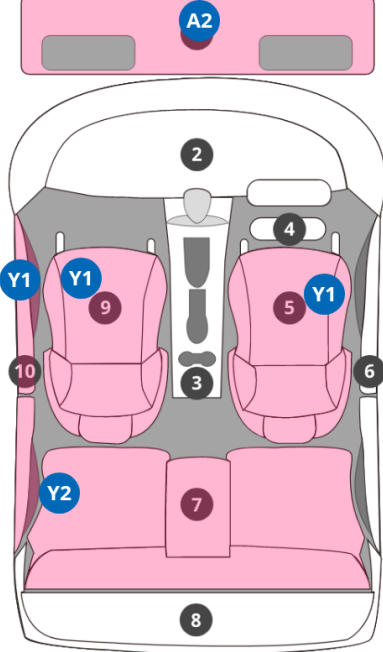
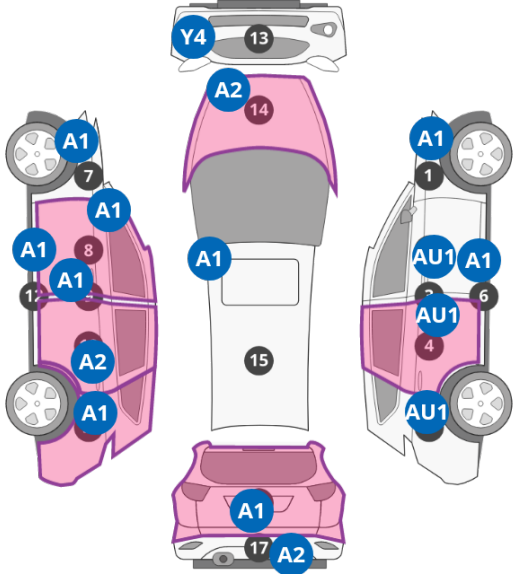
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	175.0	141	153	231
2	Boot Lid	761.3	122	1,185	977
3	Roof	99.8	99	94	108/98
4	Left Front Fender	487.3	867	302	293
5	Left Front Door	333.0	713	150	136
6	Center Panel Left				
7	Left Rear Door	127.0	120	135	126
8	Left Back Panel	255.6	152	464	151
9	Right Front Fender	106.2	113	106	100
10	Right Front Door	103.3	100	106	104
11	Center Panel Right				
12	Right Rear Door	130.3	123	138	130
13	Right Back Panel	99.2	98	97	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Cut, Crack - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Bonnet, Headlight - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With Lto plate,with warranty booklet, with spare tire, 1key, no jack and tools, scratches on headlights and taillights