

General Information

Date & Time: 16, Feb, 2026 15:24

Make	Nissan	Model	NV350
YOM	2022	Odo Meter Reading	153,991
Registration No.	NFL3837	Chassis No.	JN1TCE26Z0082109
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



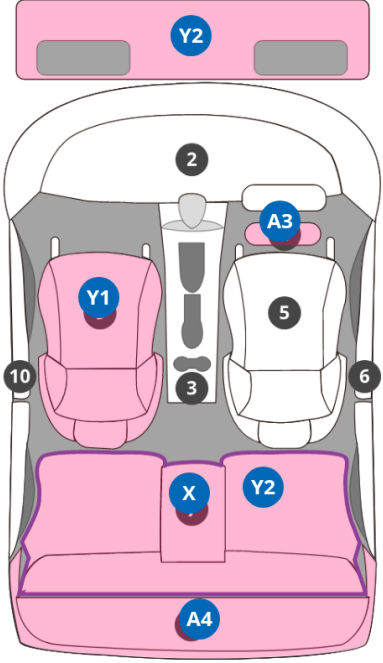
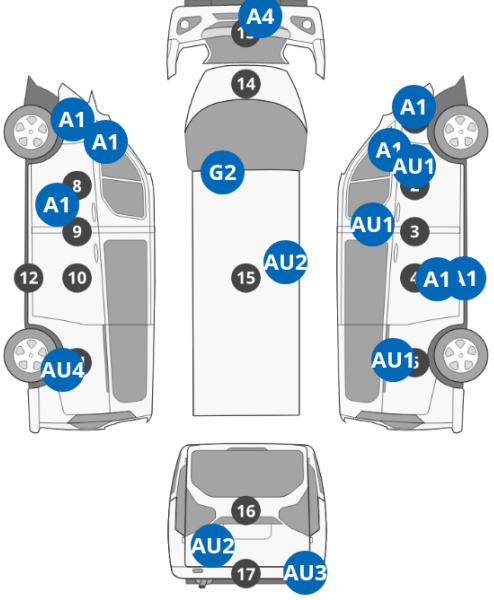
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	103	103	109
2	Boot Lid	91.4	87	98	90
3	Roof	106.7	111	113	100/103
4	Left Front Fender	110.6	116	113	103
5	Left Front Door	97.2	102	97	93
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	105.6	112	105	100
9	Right Front Fender	103.7	108	96	107
10	Right Front Door	95.9	98	89	101
11	Center Panel Right	103.8	113	111	87
12	Right Rear Door	94.8	88	99	98
13	Right Back Panel	167.3	157	169	176

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Rear Seat - Partially Missing - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Large / Rear Seat - Grime - Small</p>		<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Center Panel - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small / Front Bumper, Grille, Lamps - Scratch - Large</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights,incomplete rearseat