

General Information

Date & Time: 16, Feb, 2026 08:56

Make	Toyota	Model	Avanza
YOM	2019	Odo Meter Reading	37,354
Registration No.	NBF8651	Chassis No.	MHKM5EF2FJK017529
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



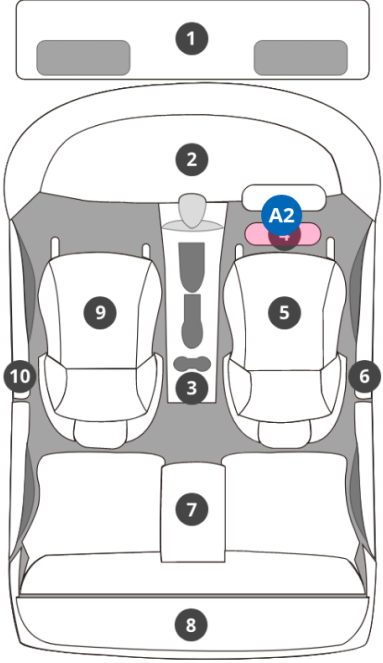
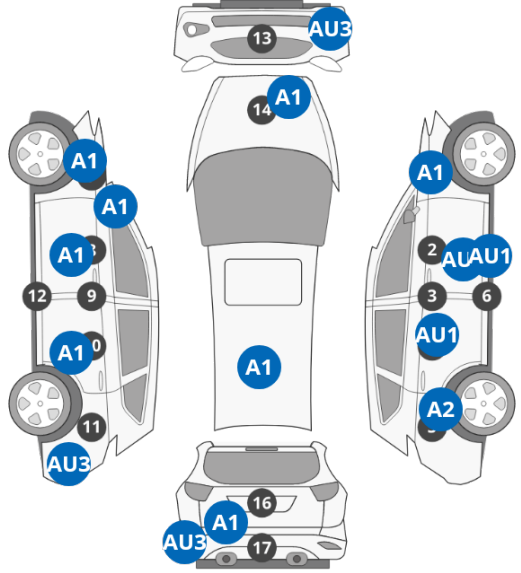
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	203.0	225	185	199
2	Boot Lid	92.1	84	103	90
3	Roof	89.2	87	86	92/92
4	Left Front Fender	102.2	102	96	109
5	Left Front Door	89.7	86	89	95
6	Center Panel Left				
7	Left Rear Door	117.3	117	116	119
8	Left Back Panel	183.6	191	178	182
9	Right Front Fender	90.9	94	93	86
10	Right Front Door	149.0	144	142	161
11	Center Panel Right				
12	Right Rear Door	134.6	142	140	122
13	Right Back Panel	133.6	117	124	160

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire, 2keys, no jack and tools, scratches on headlights and taillights