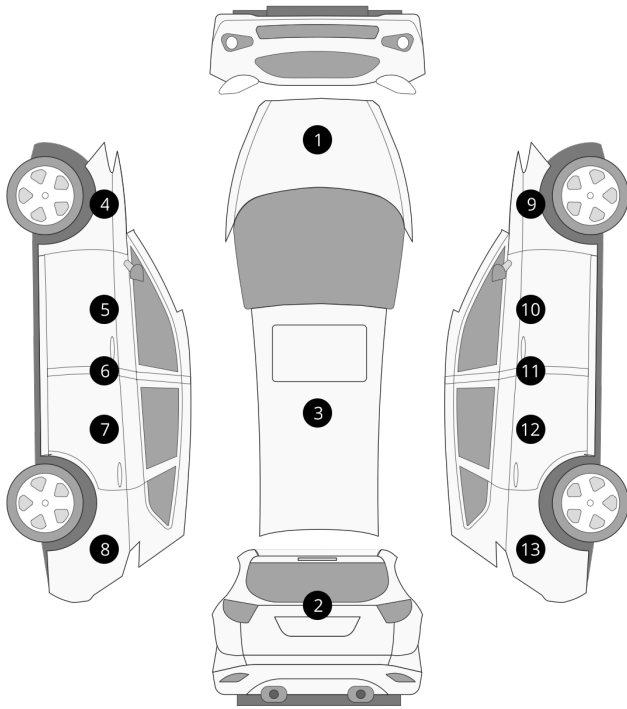


General Information

Date & Time: 14, Feb, 2026 15:59

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	139,978
Registration No.	NCT8185	Chassis No.	JN1TCE26Z0050518
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



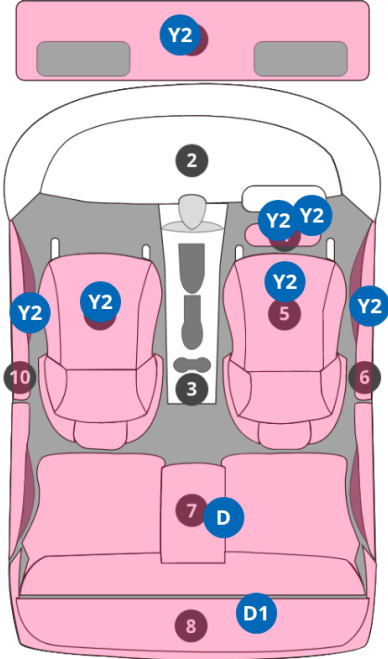
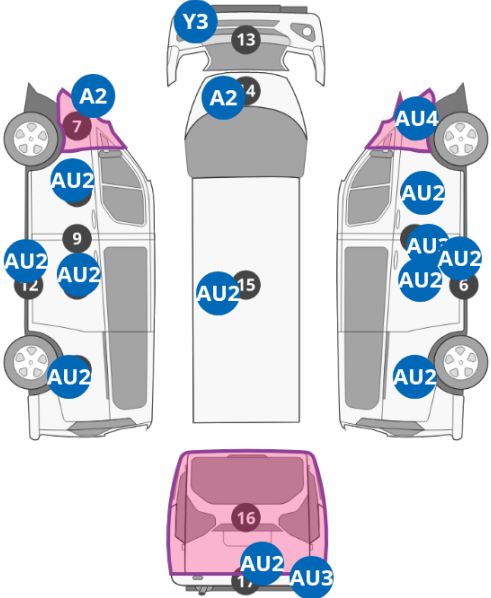
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.6	139	155	197
2	Boot Lid	432.6	252	521	525
3	Roof	84.0	81	78	89/88
4	Left Front Fender	620.3	854	863	144
5	Left Front Door	127.7	142	96	145
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	313.6	287	240	414
9	Right Front Fender	340.0	145	137	738
10	Right Front Door	95.2	95	95	96
11	Center Panel Right	99.4	106	101	91
12	Right Rear Door	100.8	104	103	96
13	Right Back Panel	112.3	114	117	106

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Worn - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Overall Exterior - Full Re-Paint in same color - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Small / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with manual booklet, no spare key, no tools, no jack, no reverse camera, scratches on taillight and headlight, issue on headlight.</p>