

General Information

Date & Time: 16, Feb, 2026 12:04

Make	Suzuki	Model	APV
YOM	2020	Odo Meter Reading	57,195
Registration No.	NGD8391	Chassis No.	MHYDN7V4MJ400273
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Mini Van
Colour	White		

Body / Panel Condition



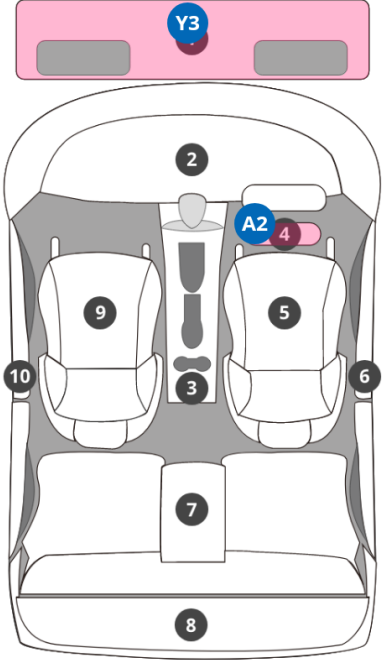
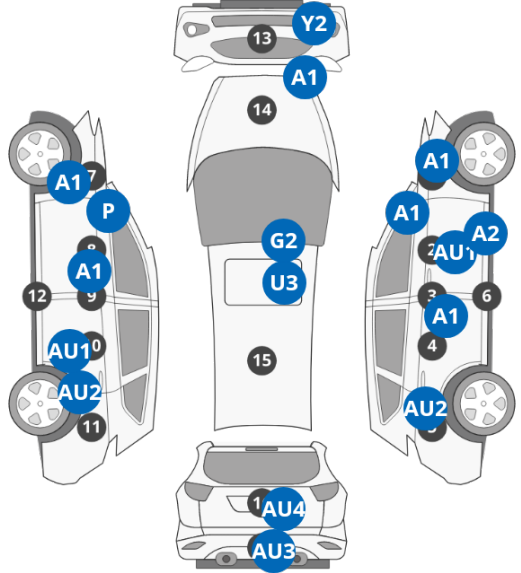
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.1	105	105	87
2	Boot Lid	113.6	112	120	109
3	Roof	83.2	75	77	90/90
4	Left Front Fender	93.8	79	98	104
5	Left Front Door	99.4	92	100	106
6	Center Panel Left				
7	Left Rear Door	103.6	104	104	103
8	Left Back Panel	106.5	127	80	113
9	Right Front Fender	99.7	99	100	100
10	Right Front Door	92.0	99	91	87
11	Center Panel Right				
12	Right Rear Door	97.2	100	95	97
13	Right Back Panel	102.0	103	96	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Carpet - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / Roof - Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Small / Front Windshield - Scratch, Stone chip - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, faded headlights, rear door issue,unusual sound on engine, stain on vehicle</p>