

General Information

Date & Time: 17, Feb, 2026 08:46

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	29,866
Registration No.	FAR9994	Chassis No.	PA1B18F37R4261349
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



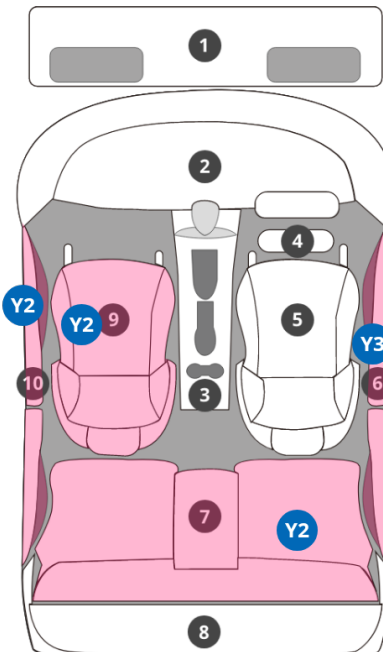
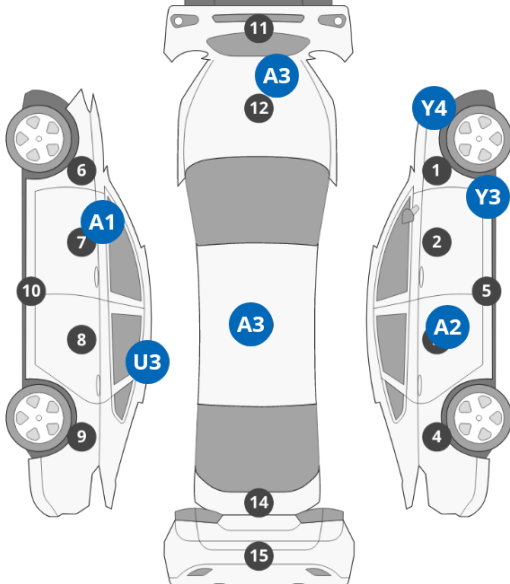
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	126	109	108
2	Boot Lid	429.0	161	933	193
3	Roof	94.9	103	92	90/95
4	Left Front Fender	450.6	274	606	472
5	Left Front Door	487.0	232	433	796
6	Center Panel Left				
7	Left Rear Door	238.6	307	181	228
8	Left Back Panel	381.6	801	208	136
9	Right Front Fender	102.8	104	99	105
10	Right Front Door	101.9	99	101	106
11	Center Panel Right				
12	Right Rear Door	124.0	171	100	101
13	Right Back Panel	108.3	115	102	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Large / (R) Front Door, Molding - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Medium / (L) Mirror - Scratch, Peeled - Minimal / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With spare tire. with jack and tools. no spare key. no warranty booklet. with seat cover</p>