

General Information

Date & Time: 17, Feb, 2026 08:47

Make	Toyota	Model	Wigo
YOM	2020	Odo Meter Reading	47,525
Registration No.	FAL7004	Chassis No.	MHKA4DE5FLJ014575
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



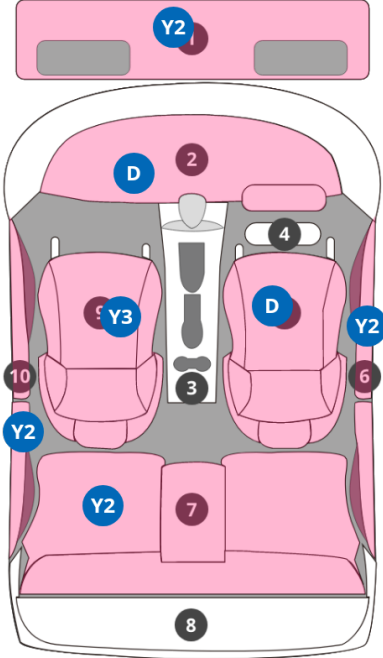
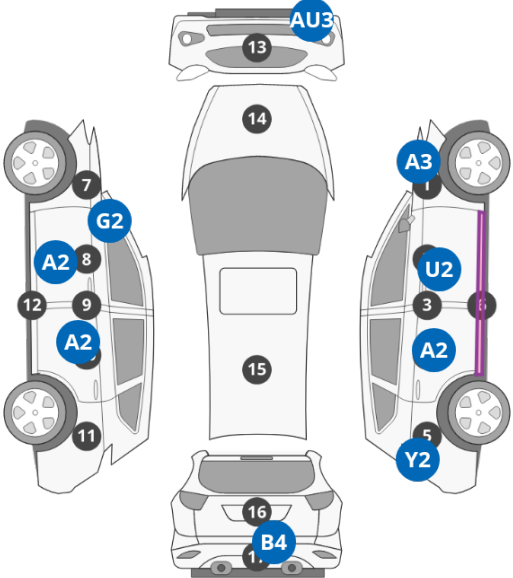
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.7	85	78	68
2	Boot Lid	92.5	94	99	85
3	Roof	65.5	55	78	64/66
4	Left Front Fender	81.4	76	85	83
5	Left Front Door	83.5	82	85	84
6	Center Panel Left				
7	Left Rear Door	87.5	79	85	99
8	Left Back Panel	87.3	84	96	82
9	Right Front Fender	91.3	113	86	75
10	Right Front Door	89.8	85	89	96
11	Center Panel Right				
12	Right Rear Door	89.8	88	90	92
13	Right Back Panel	94.3	90	90	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Worn - Yes / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Crack, Gap - Small / Rear Bumper, Lamps, Panels - Modified - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Side Window - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire. no jack and tools.with seat cover. no Battery. front and rear window damage spoiler.fade color.