

## General Information

Date & Time: 19, Feb, 2026 16:06

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	198,347
<b>Registration No.</b>	NCR3856	<b>Chassis No.</b>	JTFRT13P9J8023915
<b>CC</b>	3.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	Pearl White		

## Body / Panel Condition



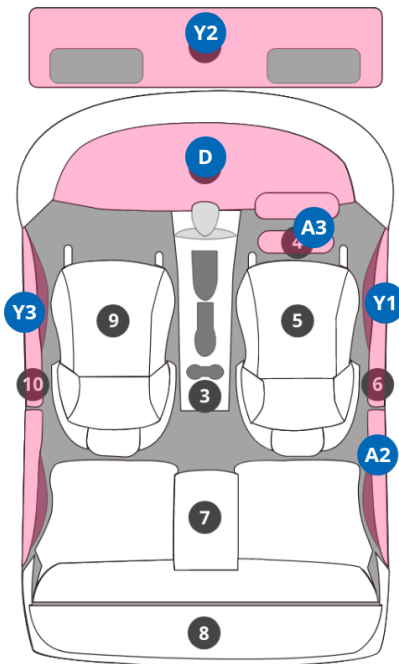
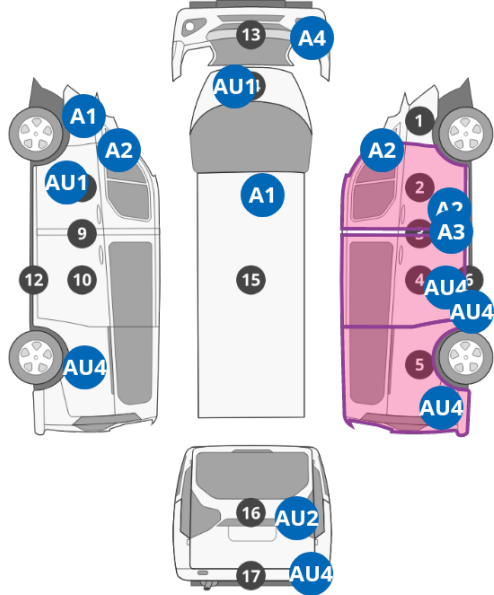
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	205.0	198	173	244
2	Boot Lid	572.6	1,167	244	307
3	Roof	200.5	197	166	187/252
4	Left Front Fender	236.6	228	243	239
5	Left Front Door	235.3	252	209	245
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	257.0	236	258	277
9	Right Front Fender	212.6	205	181	252
10	Right Front Door	169.0	219	163	125
11	Center Panel Right	282.6	238	333	277
12	Right Rear Door	819.0	1,244	753	460
13	Right Back Panel	663.6	801	828	362

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes / Carpet - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Small / (R) Front Trim - Grime - Minimal / Trim Other - Cut, Crack - Small</p>	<p><b>Remarks</b>  (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Small / Overall Exterior - Re-Paint Uneven - Yes / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, issue on rear wiper,battery weak, fog light cover partially missing</p>