

General Information

Date & Time: 17, Feb, 2026 11:06

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	192,622
Registration No.	NEO2138	Chassis No.	MR0JB8DDM318094
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Orange		

Body / Panel Condition



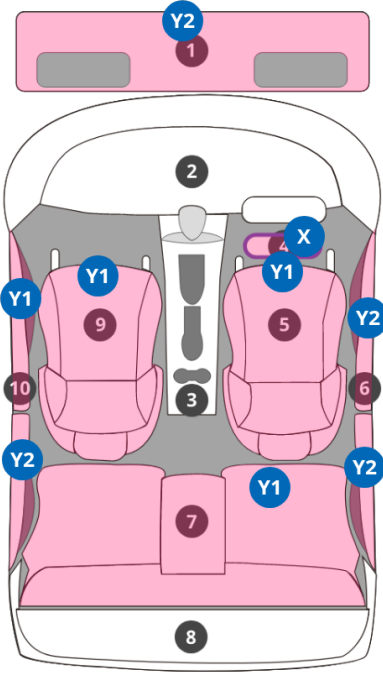
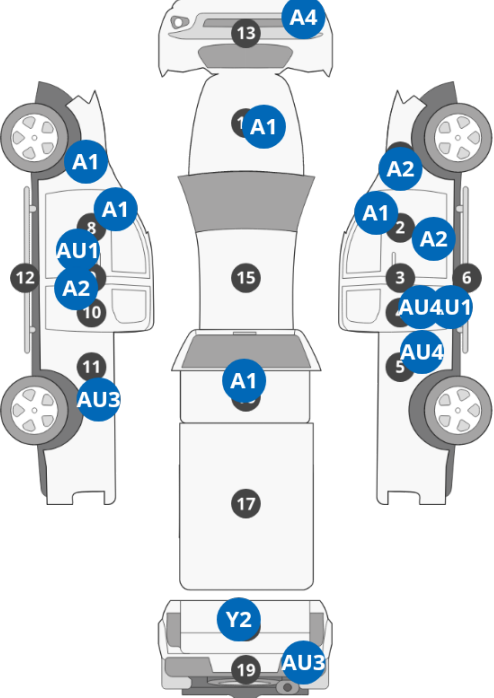
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	115	129	108
2	Boot Lid	103.3	104	100	106
3	Roof	106.6	103	98	106/120
4	Left Front Fender	112.3	115	114	108
5	Left Front Door	104.0	103	108	101
6	Center Panel Left				
7	Left Rear Door	102.3	108	101	98
8	Left Back Panel	104.3	105	100	108
9	Right Front Fender	106.6	104	107	109
10	Right Front Door	98.5	104	96	96
11	Center Panel Right				
12	Right Rear Door	100.8	102	100	101
13	Right Back Panel	109.6	116	109	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / Mat Other - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Crack, Gap - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights</p>