

General Information

Date & Time: 17, Feb, 2026 14:05

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	29,239
Registration No.	NKS2801	Chassis No.	PAHACACA4S6426141
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



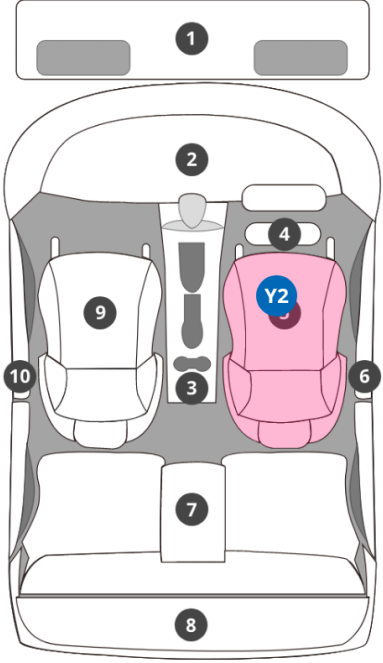
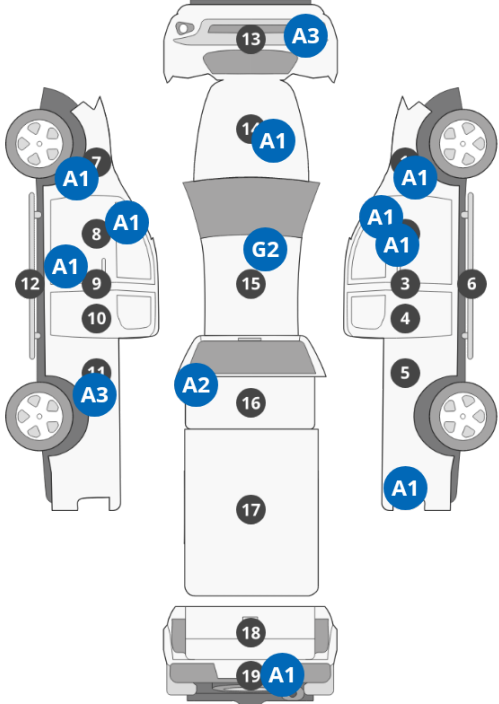
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.2	110	99	101
2	Boot Lid	53.7	51	47	63
3	Roof	114.0	123	116	107/110
4	Left Front Fender	105.2	107	96	113
5	Left Front Door	97.7	99	100	94
6	Center Panel Left	95.0	112	90	83
7	Left Rear Door				
8	Left Back Panel	66.1	71	57	71
9	Right Front Fender	104.4	114	103	96
10	Right Front Door	98.6	94	101	101
11	Center Panel Right	107.4	120	94	108
12	Right Rear Door				
13	Right Back Panel	72.0	77	71	69

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch - Medium / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 2keys, no tools, scratches on headlights