

General Information

Date & Time: 19, Feb, 2026 16:04

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	17,051
Registration No.	NHH2452	Chassis No.	PA1B18F37R4274148
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



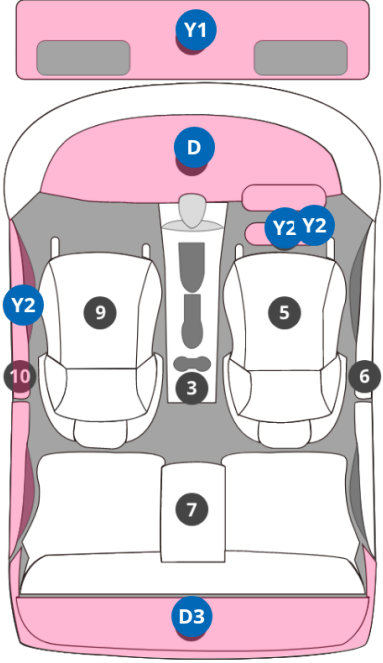
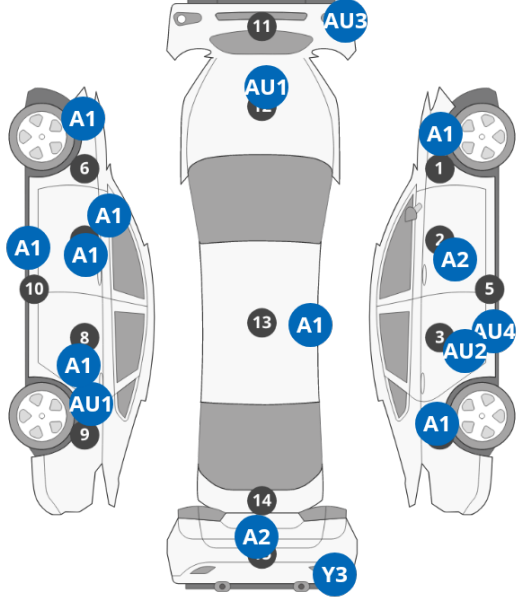
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	109	98	95
2	Boot Lid	100.6	96	97	109
3	Roof	86.4	86	93	79/88
4	Left Front Fender	89.4	90	91	88
5	Left Front Door	91.6	89	93	93
6	Center Panel Left				
7	Left Rear Door	96.5	100	98	92
8	Left Back Panel	104.2	113	98	102
9	Right Front Fender	99.6	97	104	98
10	Right Front Door	93.1	89	92	99
11	Center Panel Right				
12	Right Rear Door	93.9	96	93	93
13	Right Back Panel	95.8	92	95	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / Trunk Room - Loose, Deformed - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with jack, 1key, no warranty booklet, no spare tire and tools, scratches on headlights and taillights, trunk cover missing,</p>