

General Information

Date & Time: 19, Feb, 2026 09:10

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,175
Registration No.	NKO9509	Chassis No.	PA1B18F35S4285297
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



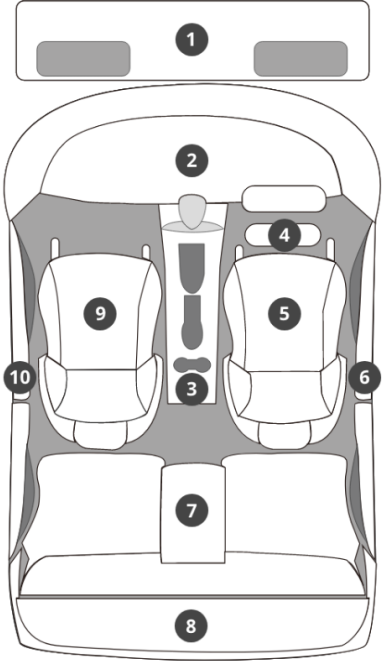
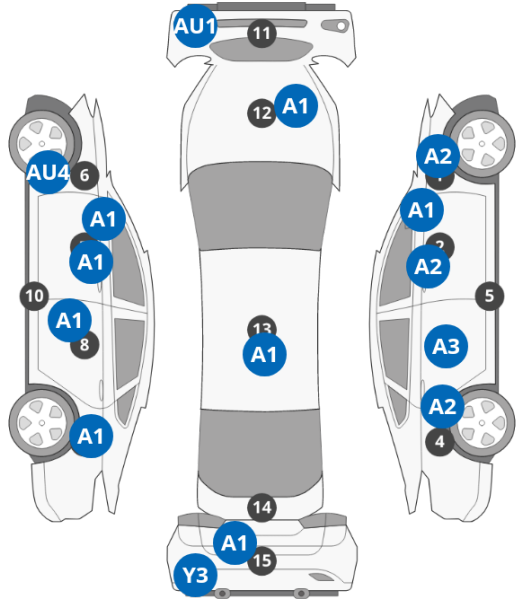
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	111	103	106
2	Boot Lid	112.3	107	111	119
3	Roof	88.6	93	90	85/86
4	Left Front Fender	228.3	275	225	185
5	Left Front Door	96.5	96	97	97
6	Center Panel Left				
7	Left Rear Door	102.6	100	100	108
8	Left Back Panel	114.3	129	107	107
9	Right Front Fender	97.6	101	96	96
10	Right Front Door	101.0	99	101	103
11	Center Panel Right				
12	Right Rear Door	95.6	92	96	99
13	Right Back Panel	98.8	94	97	106

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Defects not found</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>No Lto plate, with warranty booklet, with tools, 3keys, no spare tire and jack, scratches on headlight, Crack headlight, Crack taillight</p>