

## General Information

Date & Time: 19, Feb, 2026 09:10

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	55,148
<b>Registration No.</b>	NEF9287	<b>Chassis No.</b>	MHKA4DF5FMJ053197
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



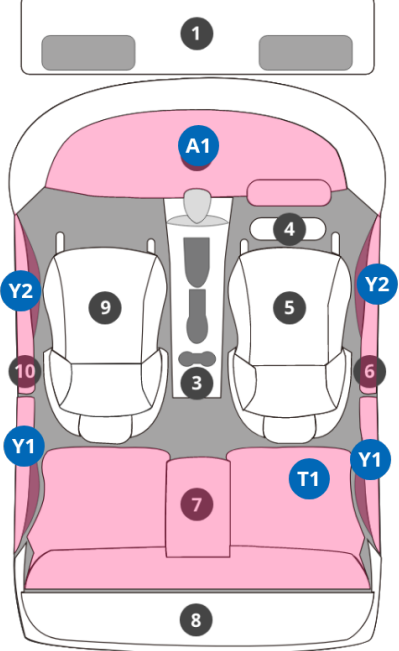
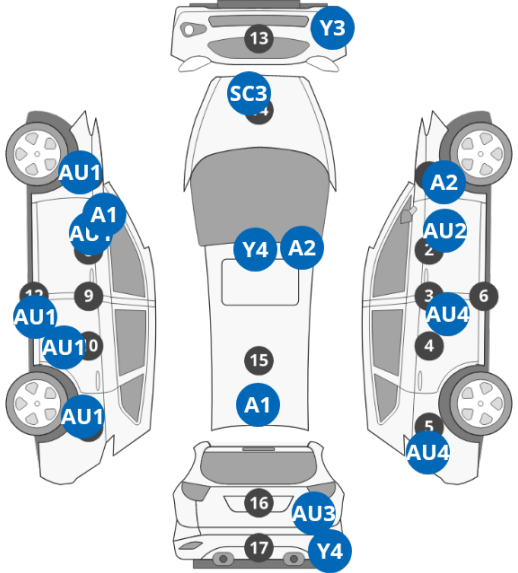
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	110	107	100
2	Boot Lid	92.7	82	98	99
3	Roof	90.9	92	92	92/88
4	Left Front Fender	89.3	84	94	91
5	Left Front Door	94.7	95	96	94
6	Center Panel Left				
7	Left Rear Door	95.8	93	98	97
8	Left Back Panel	88.7	90	94	83
9	Right Front Fender	94.5	92	99	92
10	Right Front Door	88.8	86	91	90
11	Center Panel Right				
12	Right Rear Door	93.7	104	92	85
13	Right Back Panel	91.0	97	88	88

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Cigarette Burns - Burnt Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Roof Spoiler, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Rust, Corrosion - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Front Windshield - Damaged - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights, Crack taillight and windshield, warning lamp on, battery weak