

## General Information

Date & Time: 19, Feb, 2026 16:08

<b>Make</b>	Toyota	<b>Model</b>	Rush
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	31,763
<b>Registration No.</b>	NFD1901	<b>Chassis No.</b>	MHKE8FF3MK38426
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	White		

## Body / Panel Condition



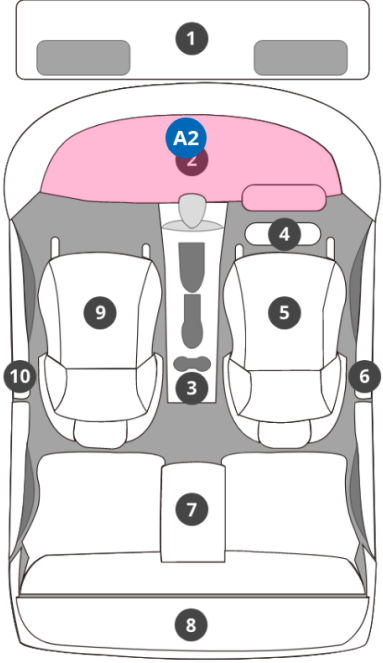
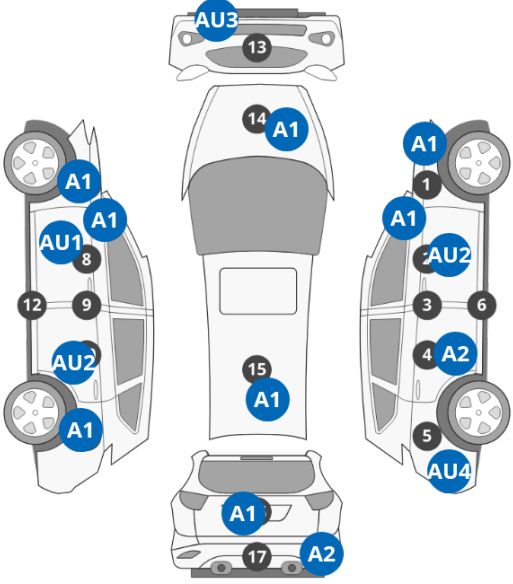
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.2	105	100	96
2	Boot Lid	96.6	92	103	95
3	Roof	83.0	76	77	94/85
4	Left Front Fender	91.0	90	94	90
5	Left Front Door	97.6	93	95	105
6	Center Panel Left				
7	Left Rear Door	105.5	112	100	105
8	Left Back Panel	93.6	102	91	88
9	Right Front Fender	97.0	103	98	90
10	Right Front Door	99.7	107	95	97
11	Center Panel Right				
12	Right Rear Door	99.5	98	98	103
13	Right Back Panel	95.8	96	93	99

**Overall Evaluation :**

A

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Steering Wheel - Worn, Peel, Crack - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Small / Roof Spoiler, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights and taillights</p>