

General Information

Date & Time: 18, Feb, 2026 15:44

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	30,975
Registration No.	NFR9020	Chassis No.	PA1B18F38R4259142
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



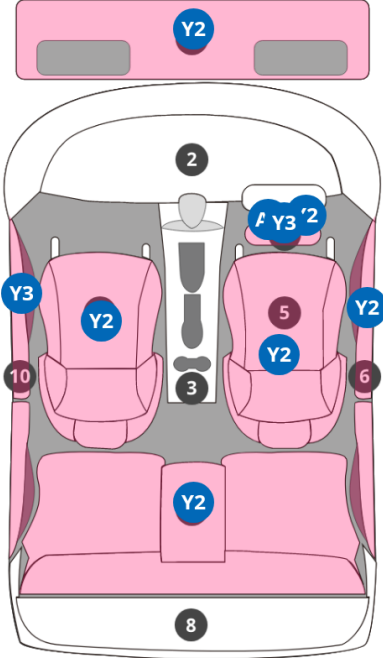
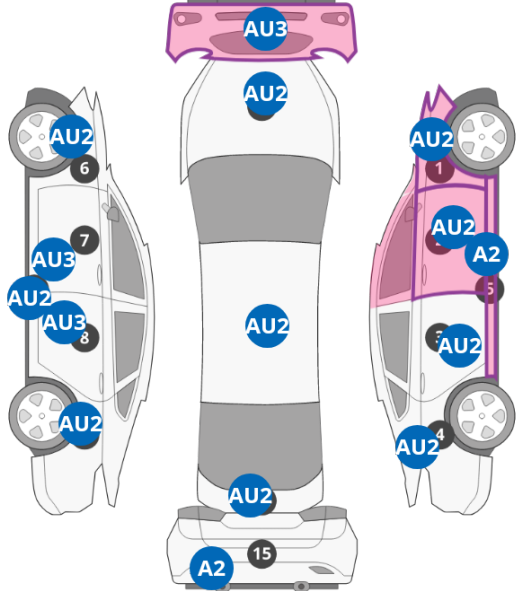
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	102	100	108
2	Boot Lid	122.0	116	107	143
3	Roof	105.5	118	106	102/96
4	Left Front Fender	144.6	158	142	134
5	Left Front Door	143.0	163	132	134
6	Center Panel Left				
7	Left Rear Door	110.3	117	108	106
8	Left Back Panel	114.3	127	115	101
9	Right Front Fender	171.6	158	142	215
10	Right Front Door	154.6	150	140	174
11	Center Panel Right				
12	Right Rear Door	166.0	157	150	191
13	Right Back Panel	108.6	103	103	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with reverse camera, no tools and jack, no warranty and manual booklet, scratches on taillight and headlight.</p>