

General Information

Date & Time: 20, Feb, 2026 10:31

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	257,356
Registration No.	GAW3465	Chassis No.	JTFNAFAP7M8022870
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



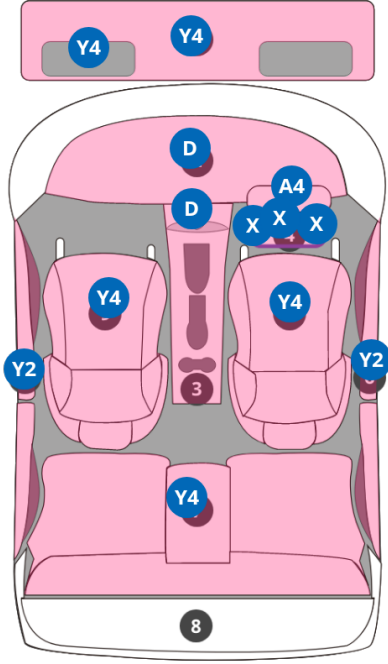
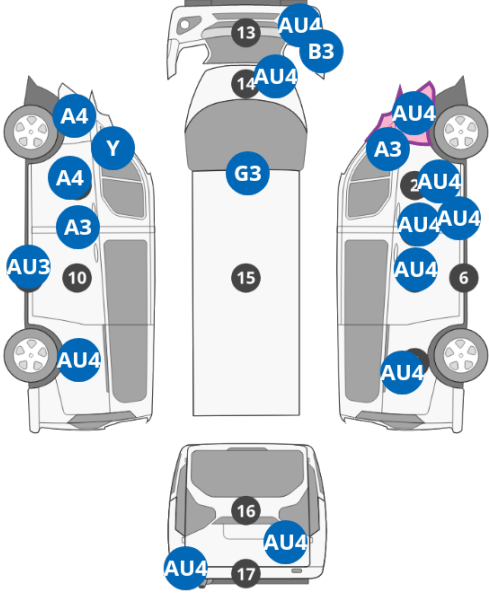
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	112	115	112
2	Boot Lid	207.3	220	198	204
3	Roof	121.6	110	79	126/171
4	Left Front Fender	143.3	149	141	140
5	Left Front Door	144.0	146	139	147
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	177.0	172	145	214
9	Right Front Fender	164.3	156	157	180
10	Right Front Door	150.3	165	149	137
11	Center Panel Right	166.3	154	201	144
12	Right Rear Door	167.0	213	142	146
13	Right Back Panel	472.0	815	220	381

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Large / (L) Front Floor Mat - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Large / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Large / (L) Front Trim - Grime - Small / Rear Seat - Grime - Large / Ceiling - Grime - Large / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Center Panel - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Partially Missing - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Large / Overall Exterior - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Modified - Medium / Front Windshield - Scratch, Stone chip - Medium</p>
Frame Evaluation : C	Functional Evaluation : E
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Non moving vehicle. Possible flooding. Battery needs replacement. not advisable to use old battery due of electrical issues. Check engine light, maintenance warning lamp and ABS warning lamp on. Crack front windshield. Damaged left side mirror. Air-conditioning, retractable and power folding side mirror, radio, rear lights, and window switches not working. Damaged front bumper, front left fender and bonnet. Gap at rear bumper. Without warranty booklet, tools, and jack. Incomplete seat cover. With spare tire. 1 key. With LTO plate.</p>