

General Information

Date & Time: 23, Feb, 2026 13:10

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	10,548
Registration No.	NHI8911	Chassis No.	PA1B18F35P4211157
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



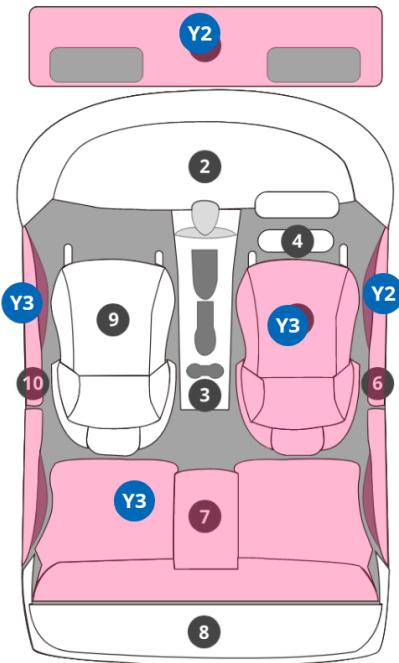
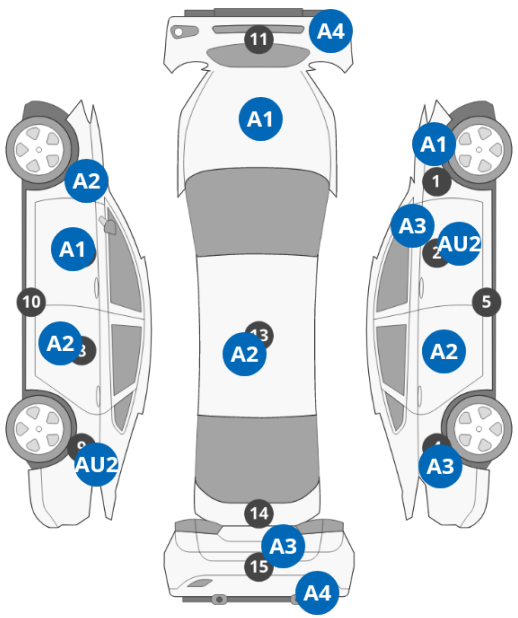
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	137	115	114
2	Boot Lid	110.3	106	105	120
3	Roof	102.2	111	99	98/101
4	Left Front Fender	104.0	101	109	102
5	Left Front Door	102.7	106	107	95
6	Center Panel Left				
7	Left Rear Door	107.0	106	107	108
8	Left Back Panel	109.6	118	108	103
9	Right Front Fender	114.0	115	115	112
10	Right Front Door	103.0	98	100	112
11	Center Panel Right				
12	Right Rear Door	108.6	107	110	109
13	Right Back Panel	108.2	97	107	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/With jack and incomplete tools/No seat cover/No reverse camera/No warranty booklet/right side mirror issue</p>